


Pavement Condition Report

Bemidji Regional Airport (BJI)

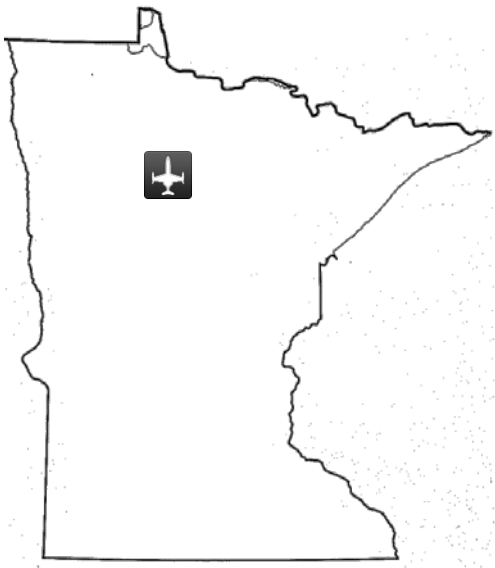

Prepared for:

Office of Aeronautics
Minnesota Department of Transportation
222 East Plato Boulevard
Saint Paul, MN 55107
(800) 657-3922

Prepared by:

Applied Research Associates, Inc.
6314 Odana Rd
Madison, WI 53719
(608) 274-6409

December 2018



Table of Contents

1. Introduction	1
1.1 Project Background.....	1
1.2 Pavement Management Approach.....	1
1.3 Scope of Work.....	2
2. Project Approach	3
2.1 Update Pavement Inventory.....	3
2.1.1 Pavement Network Definition	3
2.1.2 Naming Scheme	3
2.2 Pavement Evaluation	7
2.2.1 Distress Types	8
2.3 PCI Results.....	9
2.4 Projected PCI.....	16
3. Recommendations.....	17
3.1 Near Term Maintenance	17
3.2 Major Rehabilitation	18
3.3 Federal Guidelines	18
Appendix A - Sample Unit Maps	
Appendix B - Pictures	
Appendix C - PCI Distress Report	
Appendix D - Distress Identification	
Appendix E - Maintenance and Major Rehabilitation Policies	
Appendix F - Localized Maintenance Recommendations	
Appendix G - Maintenance Repair Guidelines	

List of Figures

Figure 1. Pavement condition life cycle.....	2
Figure 2. Network definition map.....	5
Figure 3. PCI rating scale and repair levels.....	7
Figure 4. 2018 PCI map	13
Figure 5. Condition distribution.....	15
Figure 6. Area-weighted PCI by pavement use.....	15
Figure 7. Projected PCI by percent area.....	16

List of Tables

Table 1. Branch definition.....	4
Table 2. PCI distress types.....	8
Table 3. PCI section summary table.....	10
Table 4. Summary of maintenance work plan.....	17
Table 5. Recommended 5-year major rehabilitation plan.....	18

Abbreviations and Acronyms

AAC	Asphalt Overlaid with Asphalt
AC	Asphalt Concrete
APC	PCC Overlaid with Asphalt
APMS	Airport Pavement Management System
BJI	Bemidji Regional Airport
CAD	Computer-aided Drafting
CIP	Capital Improvement Plan
FAA	Federal Aviation Administration
FOD	Foreign Object Debris
GIS	Geographic Information System
L&T	Longitudinal & Transverse Cracking
LCD	Last Construction Date
Mn/DOT	Minnesota Department of Transportation Office of Aeronautics
PCC	Portland Cement Concrete
PCI	Pavement Condition Index

1. Introduction

Since 1995, Federal grant assurances have required that to continue receiving Federal funding, airports implement a pavement maintenance-management program for any pavement constructed or repaired using Federal money. To help individual airports meet this grant assurance and improve the statewide airport system, the Minnesota Department of Transportation (Mn/DOT) Office of Aeronautics contracted with Applied Research Associates, Inc. (ARA) to provide pavement evaluation and management inspections at local airports. This report contains the results of the 2018 pavement inspections at Bemidji Regional Airport (BJI).

Pavement conditions were assessed using the Pavement Condition Index (PCI) procedure, outlined in Federal Aviation Administration (FAA) Advisory Circular (AC) 150/5380 and ASTM D5340 for airfield pavements. The PCI was developed to provide a numerical value indicating overall pavement condition that correlates well with the ratings of experienced engineers. During a PCI survey, visible signs of deterioration within a selected sample unit are recorded and analyzed. The final calculated PCI value is a number from 0 to 100, with 100 representing a pavement in excellent condition. The PCI evaluation makes possible forecasting of future deterioration and allows for accurate projections of maintenance and rehabilitative needs.

The data collected during this project were entered into the MicroPAVER pavement management software program developed by the U.S. Army Corps of Engineers, Construction Engineering Research Laboratory. The capabilities of MicroPAVER were utilized to meet the following project objectives:

- Update and store pavement inventory and condition data.
- Develop models to predict future conditions.
- Develop maintenance and repair recommendations.
- Report the results at the individual and statewide level.

1.1 Project Background

Aviation throughout Minnesota plays a key role in the movement of goods and services with an estimated overall economic impact of \$12.2 billion. Mn/DOT realizes the value in maintaining the paved facilities by implementing and updating an airport pavement management system (APMS). An APMS provides guidance for decisions regarding pavement maintenance and repair policies at an airport and can identify short-, medium-, and long-term rehabilitation needs. Mn/DOT typically has performed PCI inspections at each airport on a 3-year cycle so that the most recent pavement condition data in the APMS reflect the field conditions.

1.2 Pavement Management Approach

The main goal of any pavement management system is to identify pavements that will receive the most benefit from an optimally timed repair. By projecting the rate at which the pavement condition will deteriorate, the optimal time for applying treatments can be determined. Typically, the optimal repair time is the point at which a gradual rate of deterioration begins to increase to a much faster rate, as illustrated in figure 1. It is critical to identify this point in time to avoid higher rehabilitation costs caused by excess deterioration. Figure 1 also shows conceptually how it is cheaper to maintain pavements that are in good to fair condition, rather than wait until the poor condition requires an expensive reconstruction treatment.

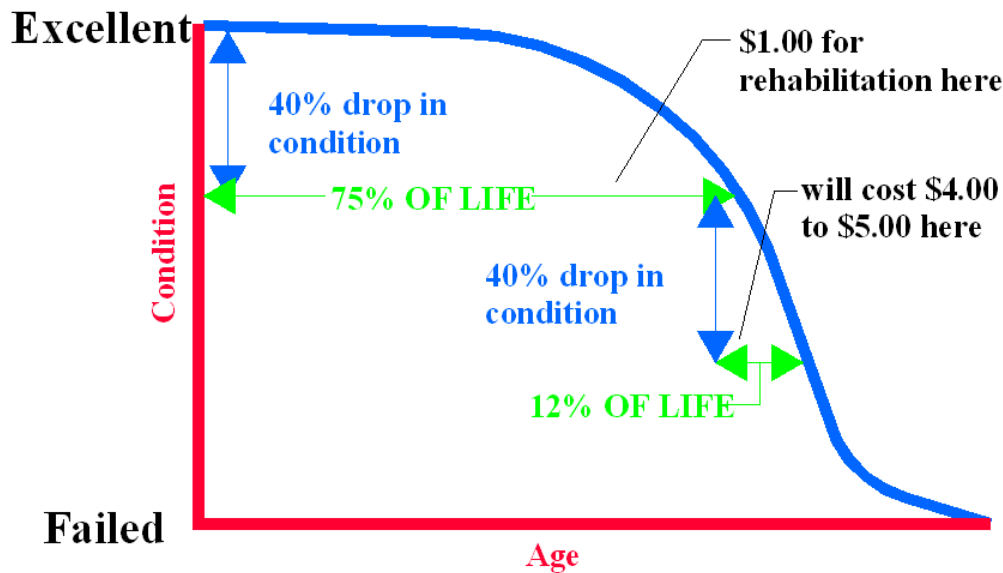


Figure 1. Pavement condition life cycle.

Often, the identified needs will cost more than the available budget and will need to be prioritized. The APMS can measure the impact of a limited budget scenario by projecting the future condition of deferred projects. Ultimately, the APMS will provide Mn/DOT and the airport a planning tool that can help identify pavement needs, optimize the selection of projects and treatments over a multi-year period, and understand the consequences of these plans.

1.3 Scope of Work

Since 2008, Mn/DOT has retained ARA to update the APMS for 106 of Minnesota’s publicly owned general aviation airports. Mn/DOT identified approximately 1/3 of the airports to be inspected each year and provided the available construction history information and existing MicroPAVER databases for each airport. ARA coordinated the PCI inspections with each airport. After the field work was completed, ARA updated the MicroPAVER database and computer-aided drafting (CAD) map for each airport. MicroPAVER was then used to develop a maintenance work plan based on current distresses. In addition, a 5-year projection identifying work levels of recommended pavement repair needs was prepared at the state level for the various stakeholders to use as a planning tool. Individual reports, such as this one, were prepared for each airport documenting the results of the pavement inspections. A statewide analysis report was prepared based on that inspection year’s airports. The airport maps were linked to the MicroPAVER database to allow for geographic information system (GIS) viewing of data. In addition, training was provided on the use of the MicroPAVER software and PCI procedure.

2. Project Approach

2.1 Update Pavement Inventory

The pavement inventory at BJI represents the airfield pavements that are intended for aviation-related traffic. The main objective in updating the pavement inventory was to determine the year of the construction (or most recent overlay), the limits of the project, and the surface type for each pavement area based on construction history. When available, Mn/DOT provided this information for the pavement-related projects for areas not already included in previous inspections. ARA then used this information to update the pavement section definitions on the CAD map and MicroPAVER database based on project limits, surface type, layer properties, traffic patterns, and overall condition.

2.1.1 Pavement Network Definition

The construction history information was used to divide the pavement network at BJI into management units—branches, sections, and sample units. A branch is a single entity that serves a distinct function. For example, a runway is considered a branch because it serves a single function (allowing aircraft to take off and land). On an airfield, a branch typically represents an entire runway, taxiway, or apron.

Because of the disparity of characteristics that can occur throughout a branch, it is further subdivided into units called sections. A section is a portion of the pavement that has uniform construction history, pavement structure, traffic patterns, and condition throughout its entire length or area. Sections are used as a management unit for the selection of potential maintenance and rehabilitation projects. The guideline used in deciding where section breaks are located is to think of the section as the "repair unit"—a portion of the pavement that will be managed independently and evaluated separately for pavement maintenance and rehabilitation.

Pavement sections are further subdivided into sample units for inspection purposes. The typical sample unit size for asphalt concrete (AC) pavements is 5,000 square feet \pm 2,000 square feet and 20 slabs \pm 8 slabs for portland cement concrete (PCC) pavements. A statistical based sampling rate was used to determine the number of sample units to inspect for each section. The inspected sample units were representative of the overall condition within a section and were used to extrapolate the condition as a whole.


2.1.2 Naming Scheme

For the pavement management system to work efficiently, some unique identifiers were added to the database. The branch names assigned were designed to assist in identification of the pavement area. The first characters are used to identify the pavement use—apron, runway, taxiway, or taxilane (pavement in and around hangar areas). The next character is a number or letter used to further identify the pavement branch (such as RY725 for Runway 7-25 or CTC for Connector Taxiway C). The sections for each branch are assigned a number starting with 001, 002, and so on. Table 1 presents the branches defined for BJI and their corresponding areas. For those airports with taxiway guidance signs, the branch ID may or may not match up with the signage in the field; however, the branch name will correspond.

Figure 2 presents the network definition for BJI and represents the pavements included in the APMS. Some privately built/maintained pavements and “driveways” leading into hangars may not be included here because they are considered outside the scope of work.

Table 1. Branch definition.

Branch Id	Name	Number of Sections	Area (SF)
ADNR	DNR APRON	2	86,100
APA	APRON A	1	85,000
APB	APRON B	4	214,885
CTC	CONNECTOR TAXIWAY C	1	23,350
CTD	CONNECTOR TAXIWAY D	1	22,300
CTJ	CONNECTION TAXIWAY J	1	73,300
PTA	PARALLEL TAXIWAY A	2	355,525
PTAX	PTA EXTENDED	1	24,950
PTB	PARALLEL TAXIWAY B	1	302,050
RY1331	RUNWAY 13-31	6	1,050,000
RY725	RUNWAY 7-25	9	829,350
TLA	TAXILANE A	1	62,000
TLB	TAXILANE B	1	17,335
TXRose	COMPASS ROSE TAXIWAY	1	21,100
Airport Total			3,167,245

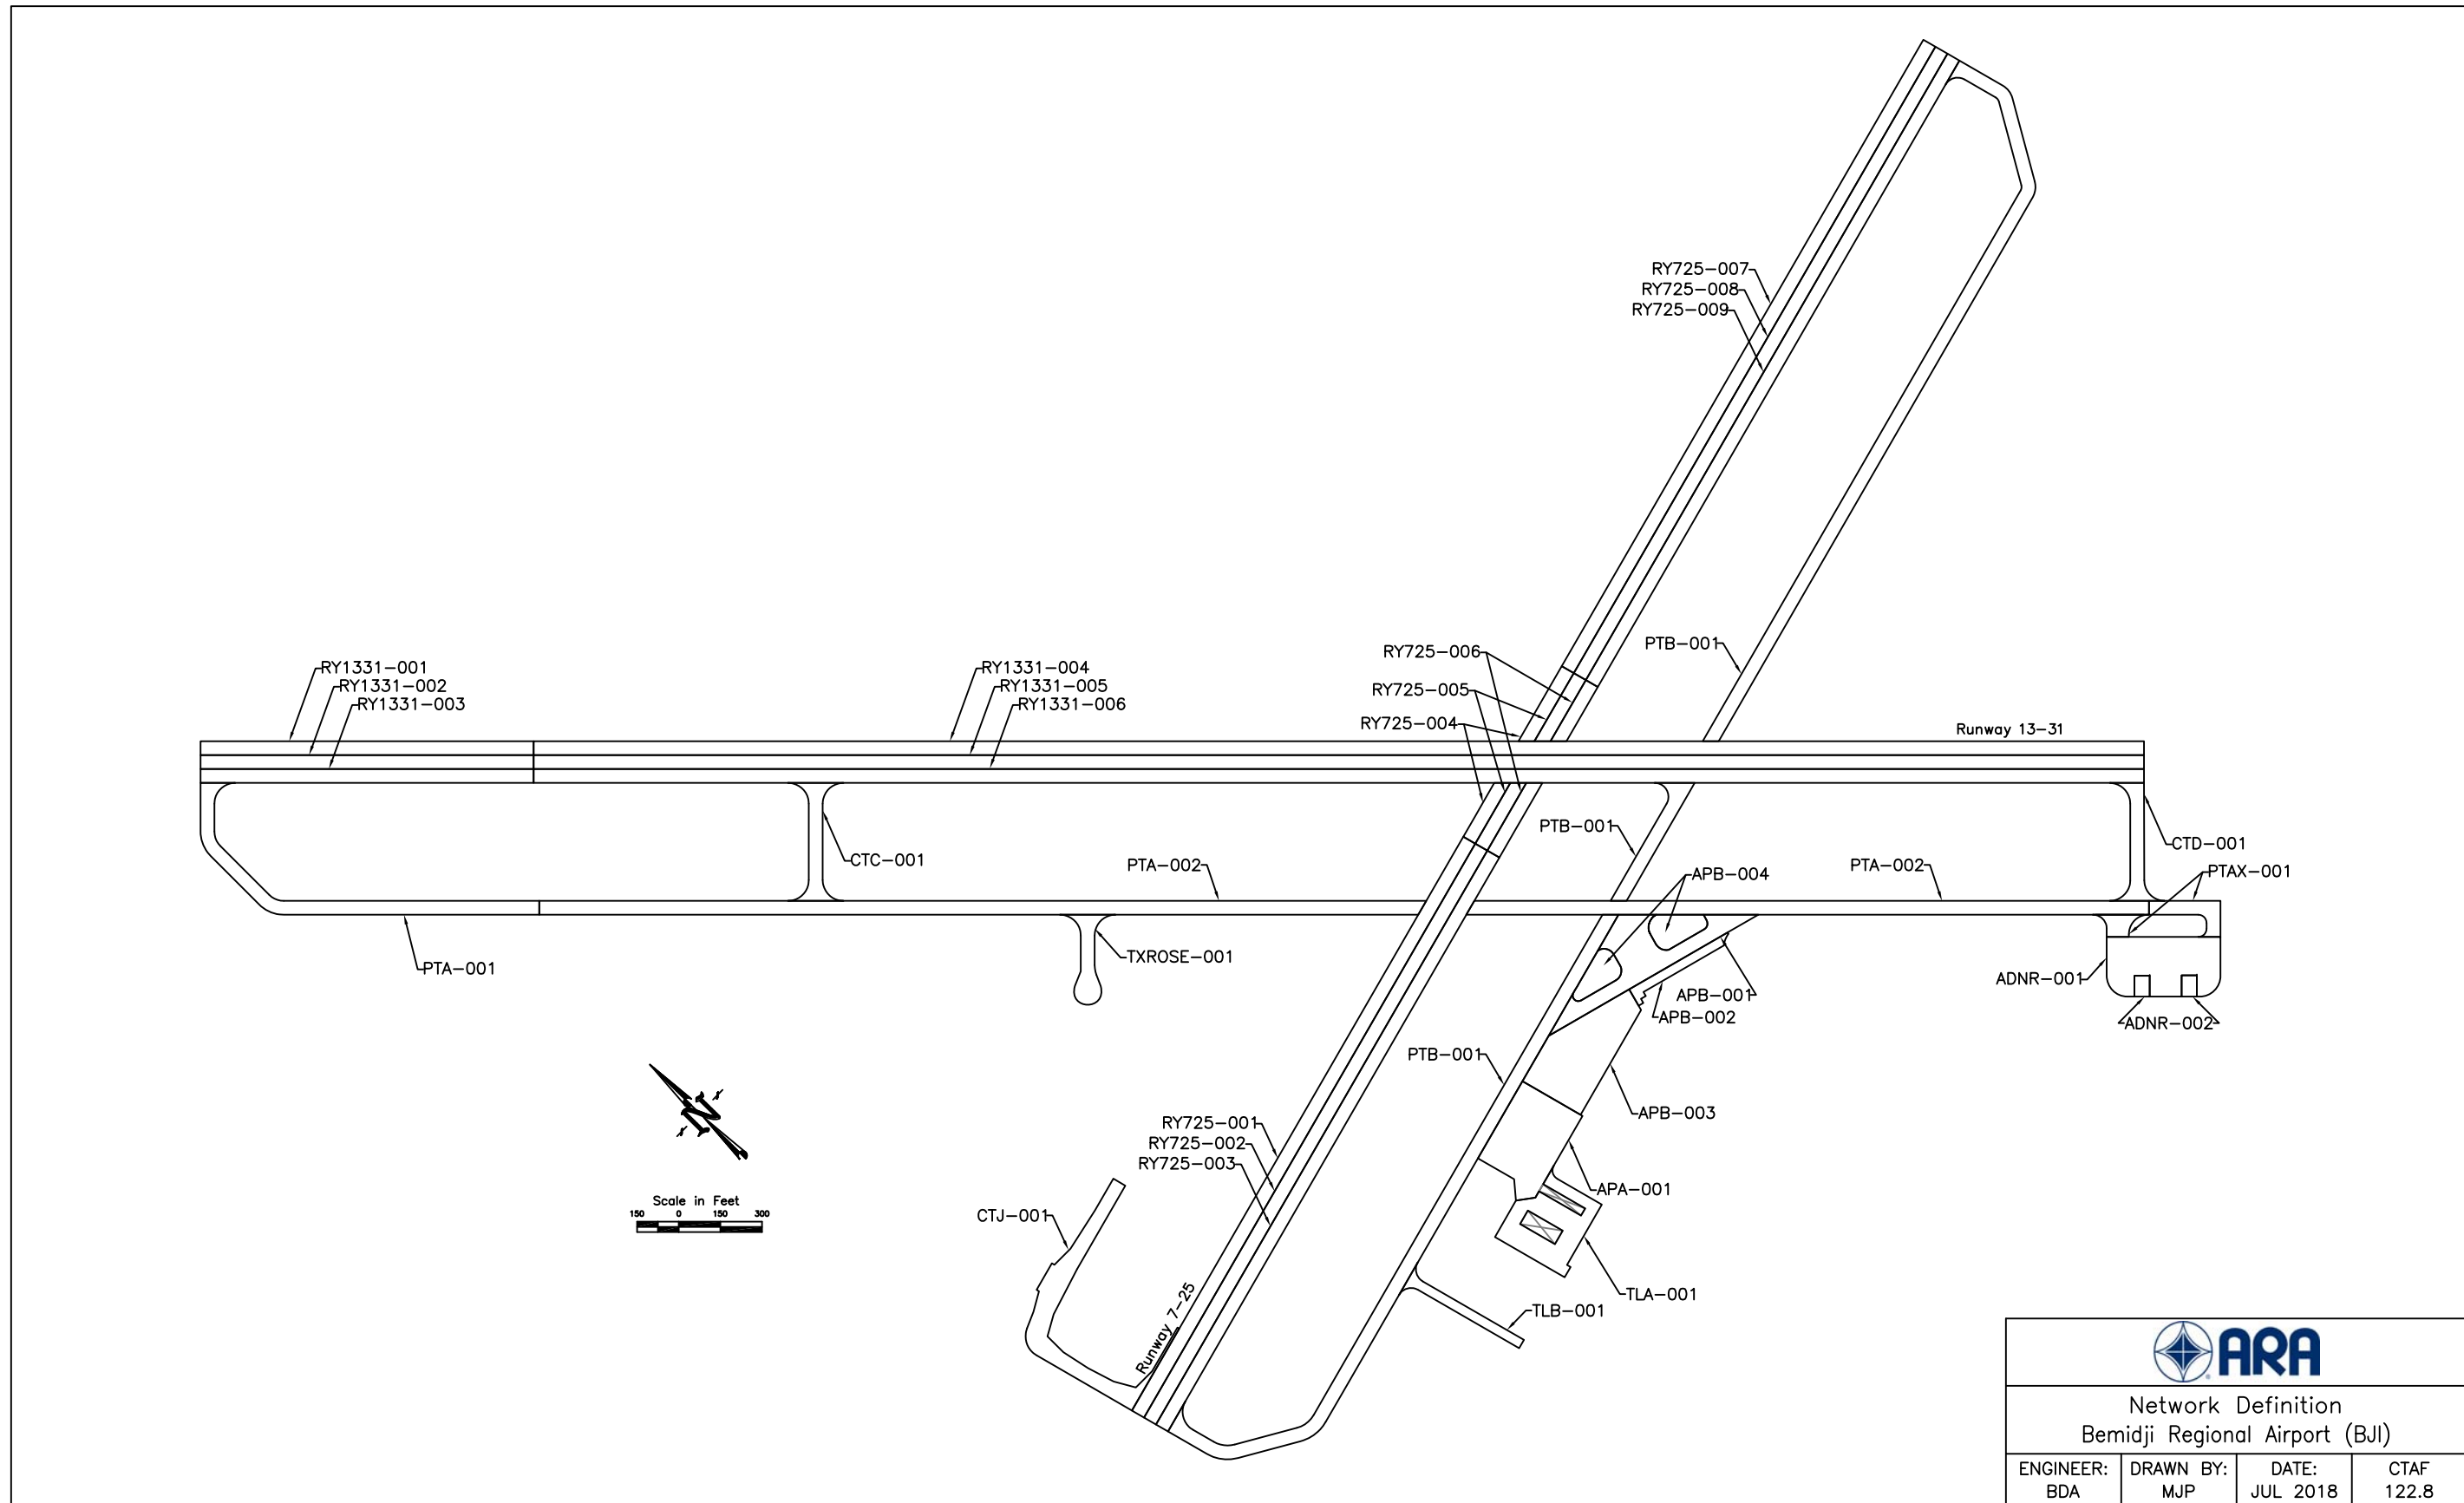

			
Network Definition Bemidji Regional Airport (BJI)			
ENGINEER:	DRAWN BY:	DATE:	CTAF
BDA	MJP	JUL 2018	122.8

Figure 2. Network Definition at Bemidji Regional Airport (BJI).

2.2 Pavement Evaluation

The pavement surfaces at BJI were visually inspected on July 1, 2018, using the PCI procedure. During a PCI inspection, inspectors walk over the surface of the pavement and identify visible signs of distress within a sample unit. Appendix A presents the scalable map used during the inspection to locate the inspected sample units. Each distress type is identified, then classified as low, medium, or high severity, and recorded on field sheets. In general, the higher the severity, the higher the foreign object damage (FOD) potential. The quantity, or extent, is measured for each distress/severity combination.

After collecting and summarizing the distress type, severity, and quantity for each of the inspected sample units, the distress data were entered into the MicroPAVER database and a PCI was calculated. The PCI procedure uses established deduct curves to determine the number of points to deduct for each distress type/severity combination, depending on the density of the distress. The inspected sample unit PCI's were then averaged to determine an overall PCI for that section.

The PCI value provides a general sense as to the level of rehabilitation that will be needed to repair a given pavement. In general terms, maintenance activities such as crack sealing and patching often provide benefit when the PCI is above 60. However, as the pavement continues to deteriorate, more complex and expensive treatments will be necessary. Pavements with a PCI between 40 and 60 are good candidates for a variety of major repairs ranging from overlays to reconstruction. Once the PCI drops below 40, reconstruction is typically the only viable alternative. Figure 3 presents the PCI inputs, rating scale, and the corresponding general work repair levels.

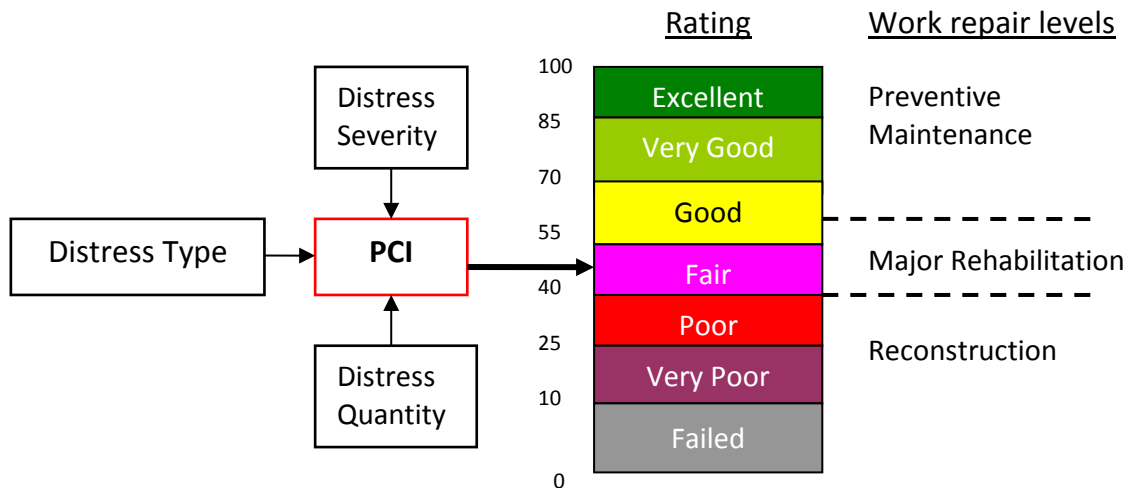


Figure 3. PCI rating scale and repair levels.

2.2.1 Distress Types

To better understand the cause of pavement deterioration, it is necessary to look at the distress types associated with each PCI. Each distress type has been classified into one of three groups based on cause—load, climate/durability, or other. Load-related distresses such as alligator cracking in asphalt pavements, or corner breaks in PCC pavements, indicate that the structural integrity of the pavement has been compromised. Climate-related distresses indicate that the pavement has aged due to seasonal environmental effects. Distresses that cannot be attributed solely to either load or climate are classified as other. Table 2 presents the asphalt and PCC distress types in the PCI procedure, their classification, and identifies which distresses were observed at BJI during the pavement inspection.

Table 2. PCI distress types.

Asphalt Distresses	Cause Classification	PCC Distresses	Cause Classification
Alligator cracking	Load	Blowup	Climate
Bleeding	Other	Corner break	Load
Block cracking	Climate	Linear cracking	Load
Corrugation	Other	Durability cracking	Climate
Depression	Other	Joint seal damage	Climate
Jet blast	Other	Small patch	Other
Joint reflection cracking	Climate	Large patch	Other
L&T cracking	Climate	Popouts	Other
Oil spillage	Other	Pumping	Other
Patching	Other	Scaling/crazing	Other
Polished aggregate	Other	Faulting	Other
Raveling	Climate	Shattered slab	Load
Rutting	Load	Shrinkage cracking	Other
Shoving	Other	Joint spalling	Other
Slippage cracking	Other	Corner spalling	Other
Swelling	Other	Alkali Silica Reaction	Climate
Weathering	Climate		

Indicates distresses found at BJI

2.3 PCI Results

The results of the 2018 PCI inspection are presented in figure 4. The overall area-weighted, inspected PCI for BJI is 81. When summarizing PCI values, an area-weighted calculation is used instead of a straight mathematical average because the area-weighted calculations eliminate the skewing of the PCI due to the disparity of the section sizes.

Figures 5 and 6 present the overall PCI for BJI by area distribution and pavement use, respectively. Table 3 presents the PCI summary for each section at BJI, including the drop in PCI per year. Generally, pavement sections will deteriorate between 1 and 3 PCI points per year. Sections deteriorating at higher rates may need maintenance above the normal application rates and should be closely monitored in case major repairs become necessary earlier than expected.

Appendix C contains the detailed inspection report with sample unit data produced from MicroPAVER. Appendix D describes the distress types most commonly identified during the PCI inspections of Minnesota airports.

Table 3. PCI section summary table.

Branch ID	Section ID	Surface type ¹	Section area (SF)	LCD ²	2015 PCI	2018 PCI	Drop in PCI/Yr ³	% Deduct due to		Distress types
								Load ⁴	Climate ⁵	
ADNR	001	AC	78,100	1995	70	63	1.6	-	100	L&T cr, Weathering
ADNR	002	PCC	8,000	1995	99	99	0.0	-	-	Shrinkage cr
APA	001	AAC	85,000	2002	84	86	0.9	-	82	L&T cr, Oil spillage
APB	001	PCC	72,650	1949	95	94	0.1	-	23	Jt seal damage, Large patch, Joint spall, Corner spall
APB	002	PCC	12,900	1974	83	70	0.7	47	-	Linear cr, Small patch, Large patch, Scaling, Corner spall
APB	003	PCC	93,245	1974	58	49	1.2	83	3	Corner break, Linear cr, Jt seal damage, Large patch, Faulting, Shat. slab, Shrinkage cr, Joint spall, Corner spall
APB	004	PCC	36,090	1989	91	81	0.7	-	30	Jt seal damage, Joint spall
CTC	001	AC	23,350	2008	91	91	0.9	-	100	L&T cr
CTD	001	AC	22,300	2008	93	82	1.8	-	100	L&T cr, Weathering
CTJ	001	AC	73,300	2018	-	100	0.0	-	-	-
PTA	001	AC	75,525	2008	98	93	0.7	-	100	L&T cr, Weathering
PTA	002	AC	280,000	2006	85	88	1.0	-	100	L&T cr
PTAX	001	AC	24,950	2006	83	82	1.5	-	100	L&T cr, Weathering
PTB	001	AC	302,050	2006	78	86 ⁶	1.2	-	100	L&T cr
RY1331	001	AC	60,000	2008	96	86	1.4	-	100	L&T cr, Weathering
RY1331	002	AC	60,000	2008	88	77	2.3	-	100	L&T cr, Weathering
RY1331	003	AC	60,000	2008	93	78	2.2	-	100	L&T cr, Weathering
RY1331	004	AC	290,000	2008	89	86	1.4	-	100	L&T cr, Weathering
RY1331	005	AC	290,000	2008	83	79	2.1	-	100	L&T cr, Weathering
RY1331	006	AC	290,000	2008	87	81	1.9	-	100	L&T cr, Weathering
RY725	001	AC	119,150	2006	89	81	1.6	-	100	L&T cr, Weathering
RY725	002	AC	119,150	2006	86	79	1.8	-	100	L&T cr, Weathering
RY725	003	AC	119,150	2006	86	82	1.5	-	100	L&T cr, Weathering
RY725	004	AC	26,800	2008	93	81	1.9	-	100	L&T cr, Weathering

Branch ID	Section ID	Surface type ¹	Section area (SF)	LCD ²	2015 PCI	2018 PCI	Drop in PCI/Yr ³	% Deduct due to		Distress types
								Load ⁴	Climate ⁵	
RY725	005	AC	26,800	2008	81	77	2.3	-	100	L&T cr, Weathering
RY725	006	AC	26,800	2008	94	83	1.7	-	100	L&T cr, Weathering
RY725	007	AC	130,500	2006	88	79	1.8	-	100	L&T cr, Weathering
RY725	008	AC	130,500	2006	83	78	1.8	-	100	L&T cr, Weathering
RY725	009	AC	130,500	2006	88	84	1.3	-	100	L&T cr, Weathering
TLA	001	AC	62,000	1970	25	21	1.6	26	73	Alligator cr, Block cr, Depression, L&T cr, Weathering
TLB	001	AC	17,335	2007	88	89	1.0	-	100	L&T cr
TXRose	001	AC	21,100	2008	98	95	0.5	-	100	L&T cr

¹AC = asphalt cement; AAC = asphalt overlaid with asphalt; PCC = portland cement concrete; APC = PCC overlaid with asphalt

²LCD = last construction date (original construction, last overlay, or reconstruction [whichever is most recent])


³Drop in PCI/Yr = $(100 - \text{PCI}) / \text{age}$ where age = 2018 - LCD

⁴Percent of deduct due to load = Percentage of PCI points subtracted from 100 for load related distresses

⁵Percent of deduct due to climate = Percentage of PCI points subtracted from 100 for climate/durability related distresses

⁶Increase in PCI due to **crack sealing done between 2015 and 2018 inspections.**

This page intentionally left blank.

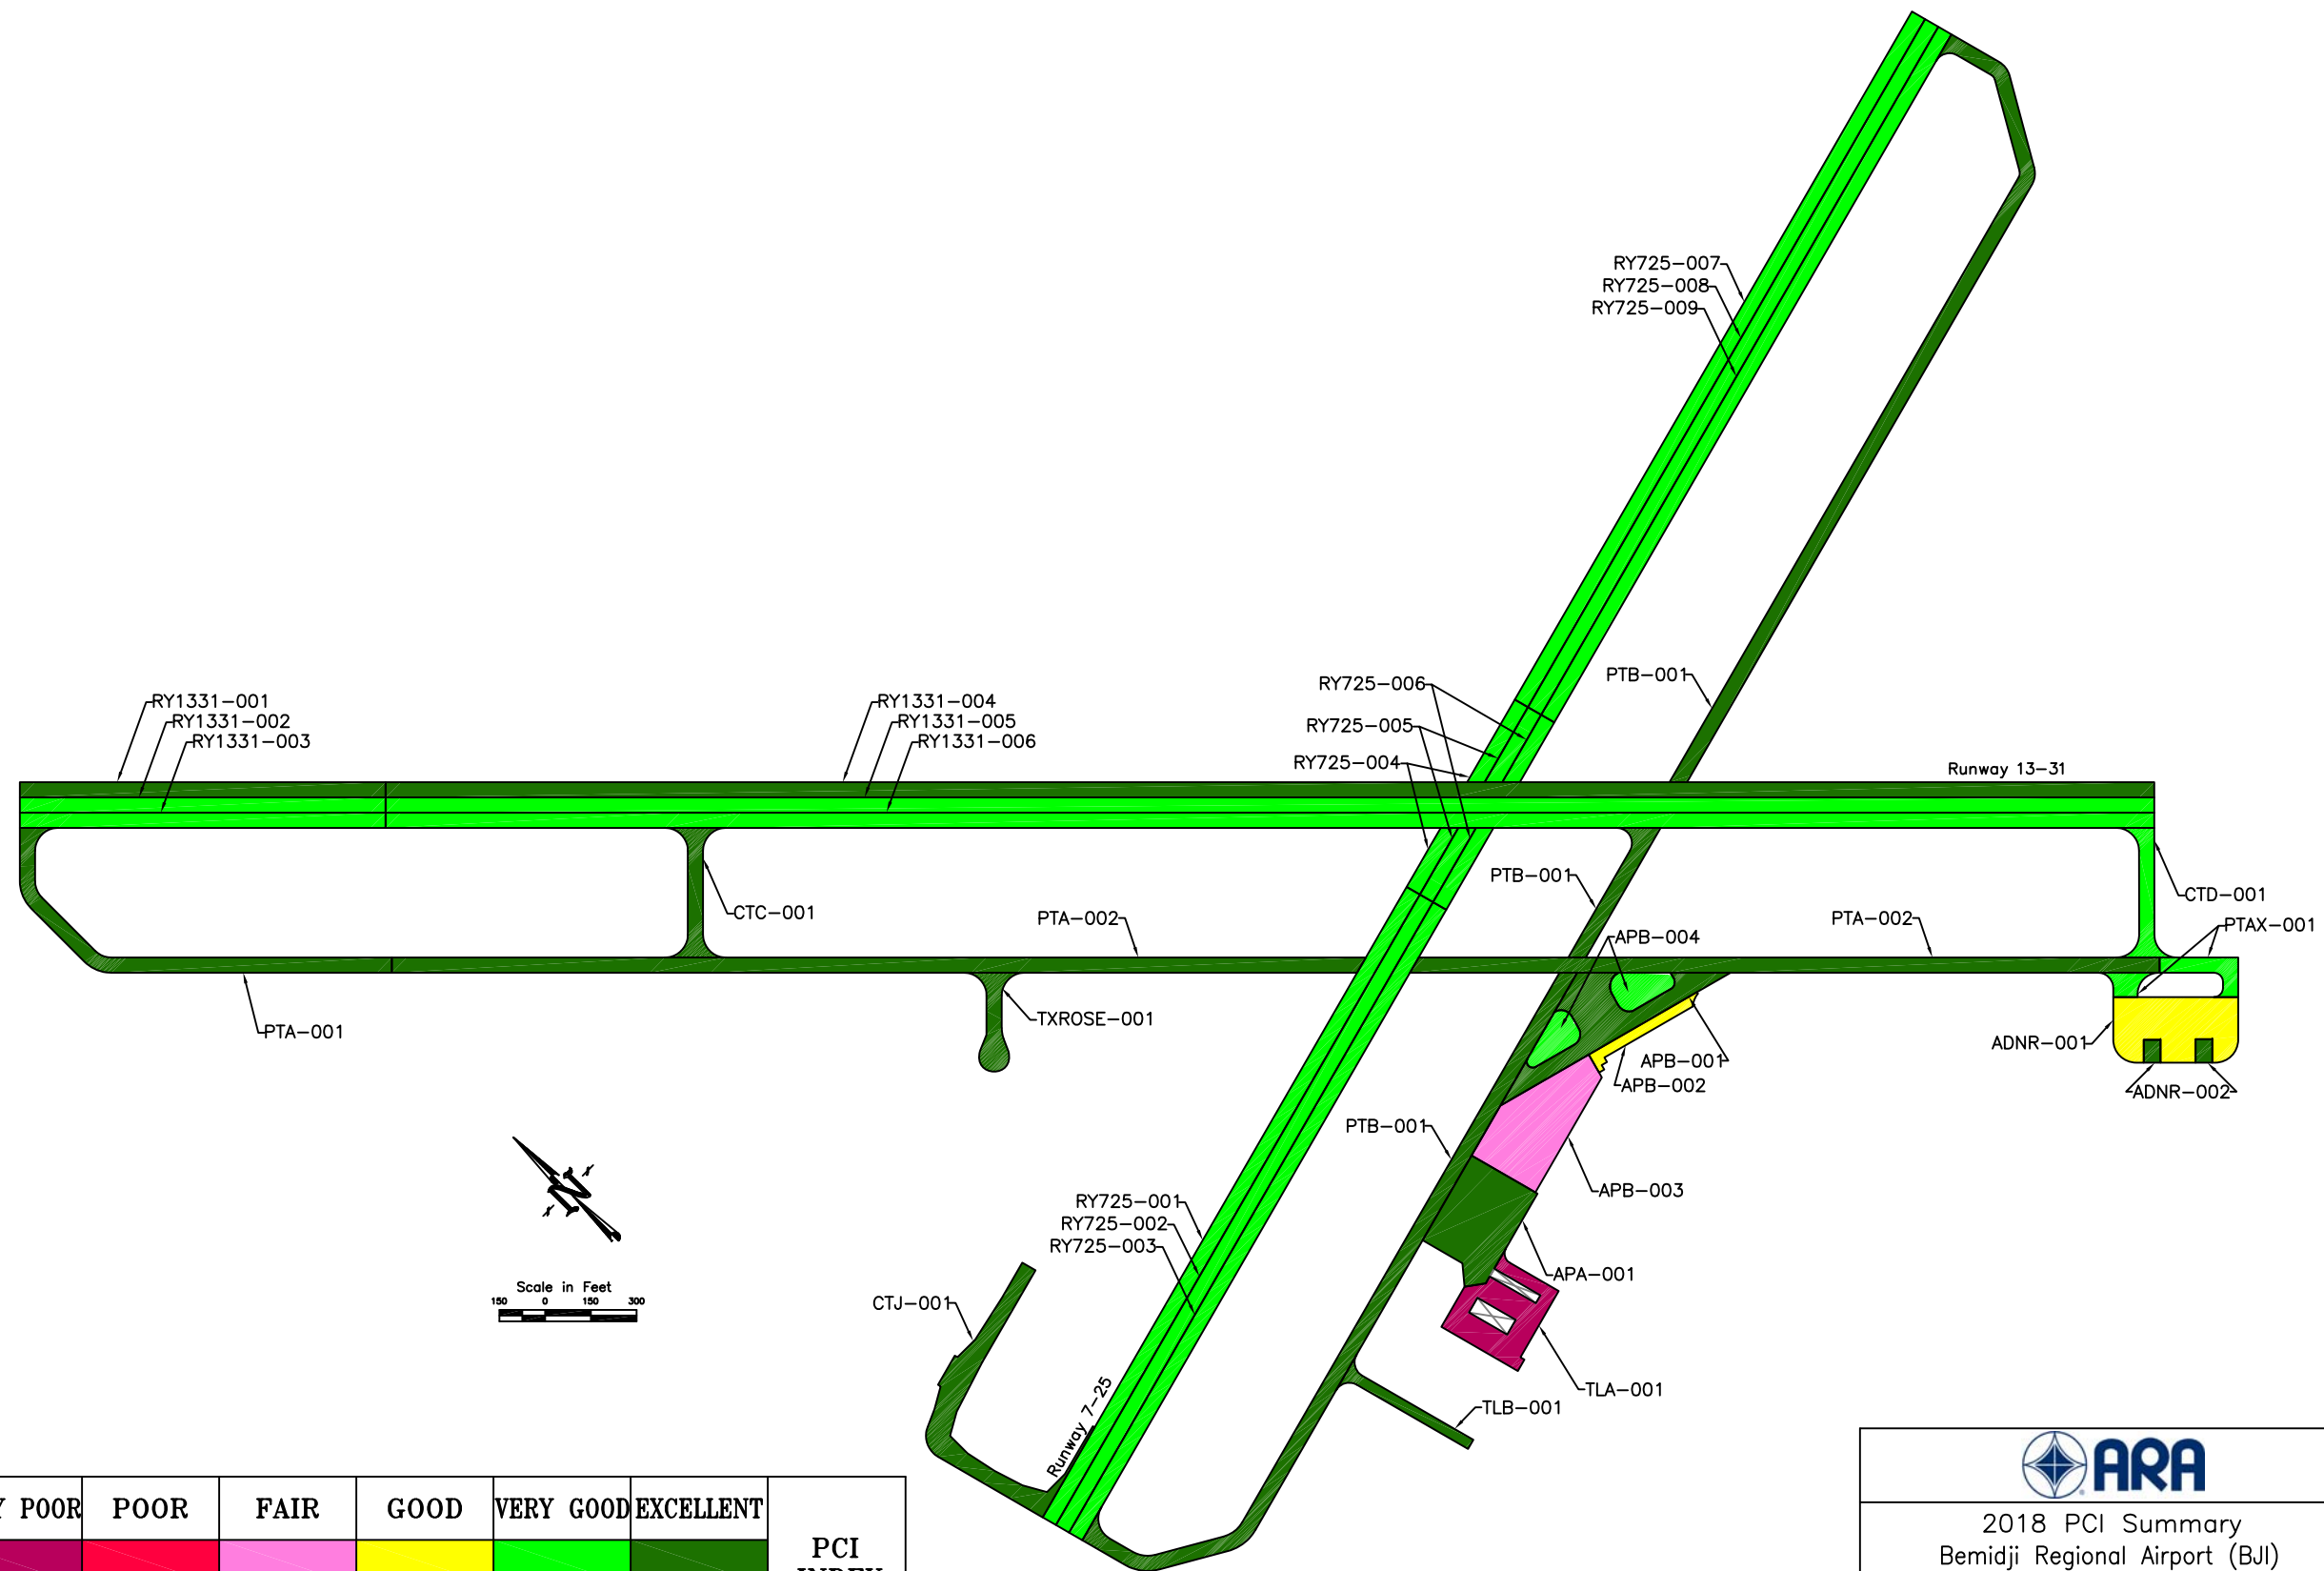

	FAILED	VERY POOR	POOR	FAIR	GOOD	VERY GOOD	EXCELLENT	PCI INDEX
NS	0-10	11-25	26-40	41-55	56-70	71-85	86-100	


 2018 PCI Summary
 Bemidji Regional Airport (BJI)

ENGINEER: BDA	DRAWN BY: MJP	DATE: JUL 2018	CTAF 122.8
------------------	------------------	-------------------	---------------

Figure 4. 2018 Pavement Condition Index Rating at Bemidji Regional Airport (BJI).

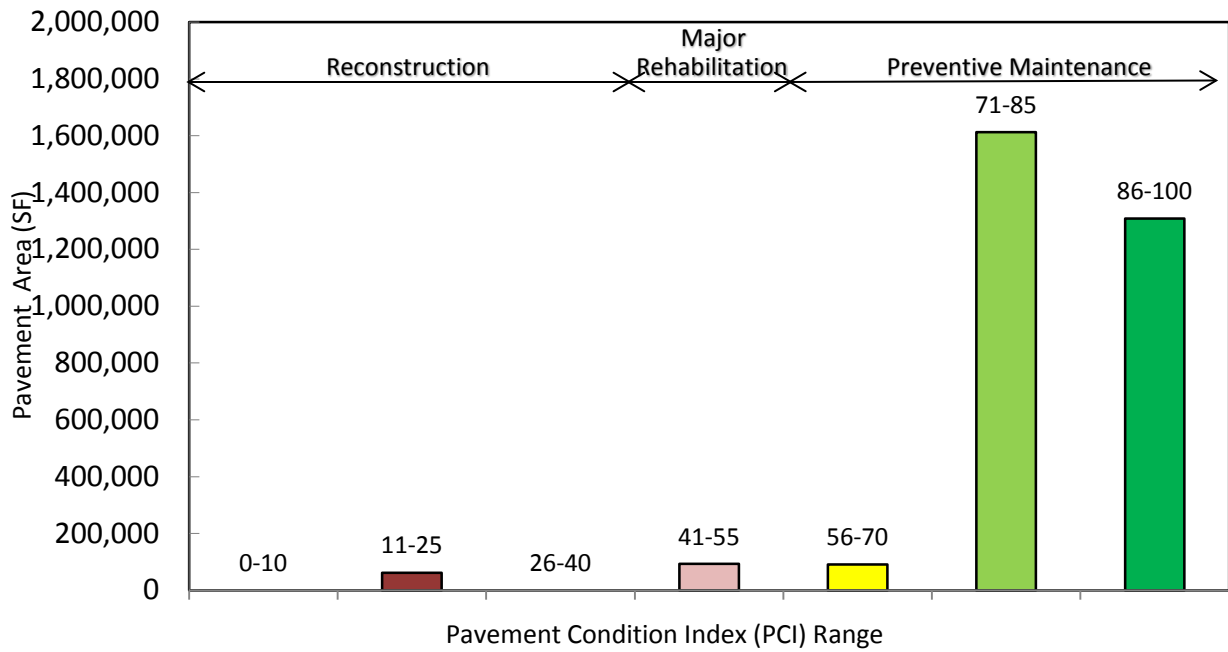


Figure 5. Condition distribution.

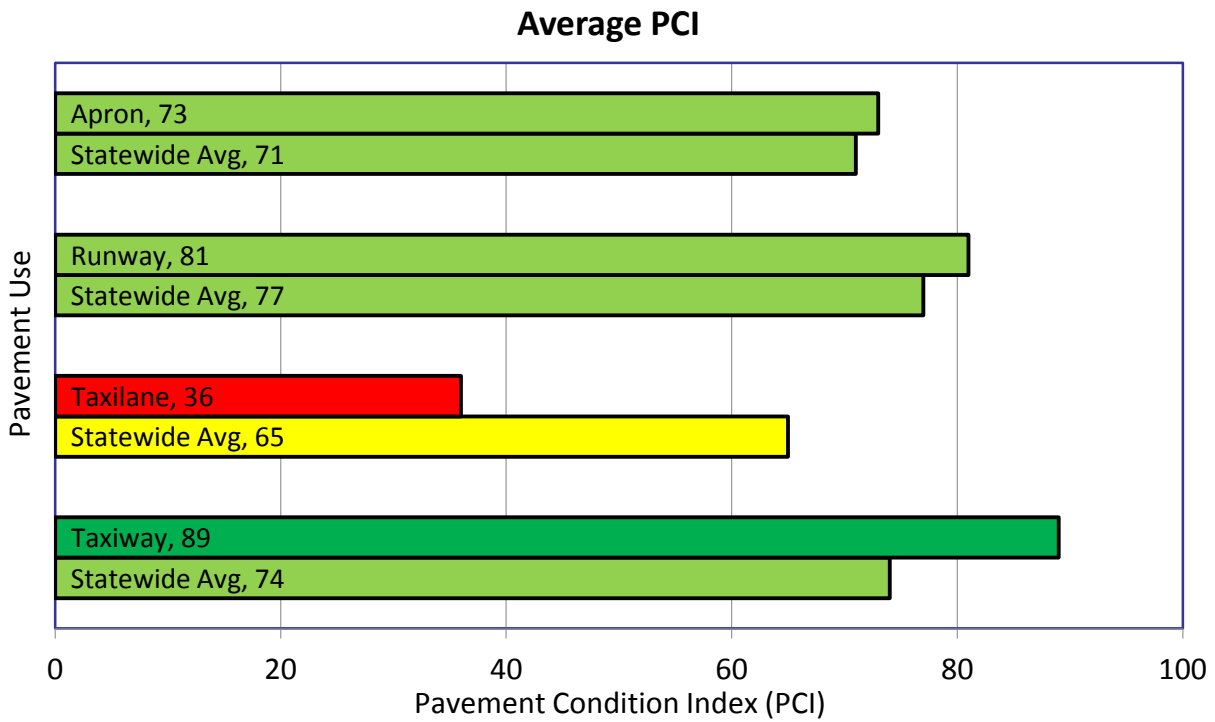


Figure 6. Area-weighted PCI by pavement use.

2.4 Projected PCI

After the 2018 distress data was entered into MicroPAVER and the PCI determined, a modeling approach was used to predict future PCI levels based on historical PCI data from Mn/DOT's airports. Pavements were grouped together in performance families based on similar construction, traffic, pavement use, and other factors affecting pavement performance. These performance models predict future PCI, not future distresses.

Figure 7 shows the projected PCI at BJI by percent area for the next 5 years assuming no major repairs (overlays, reconstruction, etc.) are performed during that period. It shows how quickly a pavement network can deteriorate when no capital improvements are made.

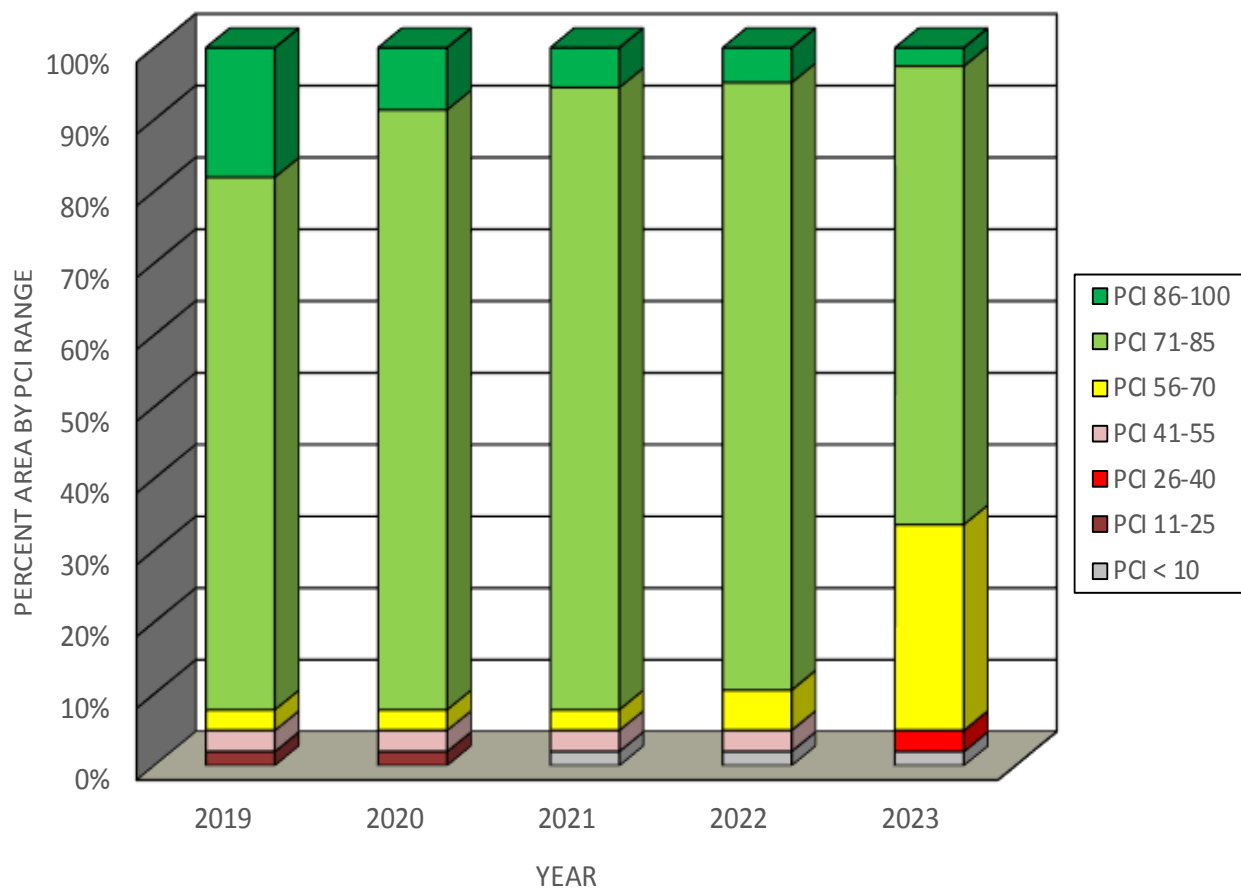


Figure 7. Projected PCI by percent area.

3. Recommendations

A 5-year maintenance and rehabilitation program was developed for BJI based on the 2018 pavement inspections and the anticipated PCI deterioration for this period. The recommendations are divided into two categories—near term maintenance (Local M&R) and major rehabilitation (Major M&R). The near term maintenance is intended to address annual maintenance needs such as crack sealing and localized patching. The major rehabilitations are applied globally and are capable of returning the pavement to a nearly distress free-state. Costs for both categories are based on industry averages and may have to be adjusted to account for local costs.

The last portion of the report covers the FAA Grant Assurance Number 11 and the steps the airport must take to remain in compliance with this program.

3.1 Near Term Maintenance

Near term maintenance is considered activities such as crack sealing, patching, and surface treatments that help to slow down the rate that a pavement is deteriorating. Localized maintenance policies and unit costs were developed with Mn/DOT for both asphalt and PCC surfaces; each policy presents the recommended maintenance treatment for each distress/severity combination and are presented in appendix E.

Table 4 presents the summarized maintenance work quantities and estimated cost to apply this near term maintenance plan at BJI. The repair quantities are based on extrapolated distress quantities from the 2018 PCI inspection. National averages of unit costs are used to estimate total costs for each treatment type; adjustments of local unit costs rates may be necessary for each airport to more accurately determine the maintenance budgetary needs.

Table 4. Summary of maintenance work plan.

Work Description	Work Quantity	Work Units	Unit Cost	Work Cost
Crack Sealing - AC	12,891	Ft	\$1.26/Ft	\$16,242
Crack Sealing - PCC	2,001	Ft	\$1.92/Ft	\$3,842
Joint Seal (Localized)	2,238	Ft	\$1.92/Ft	\$4,296
Patching - AC Deep	5,075	SqFt	\$11.82/SqFt	\$59,991
Patching - AC Shallow	12,880	SqFt	\$7.95/SqFt	\$102,396
Patching - PCC Full Depth	111	SqFt	\$74.32/SqFt	\$8,220
Patching - PCC Partial Depth	250	SqFt	\$10.68/SqFt	\$2,664
Surface Treatment	2,315	SqFt	\$0.52/SqFt	\$1,204
Total				\$198,854

Detailed results are reported by section and by treatment type in appendix F. Table F1 summarizes the maintenance that could be done for each pavement section by type of repair, and estimated quantity of repair. Likewise, table F2 summarizes the quantity for each repair type across the entire airport.

When using this plan, it is recommended that the entire section be viewed to determine whether the identified distress types are so advanced in density and severity that maintenance efforts will no longer be cost-effective. Maintenance treatments are most cost-effective when applied to pavements that are

generally in good condition. It is also important to understand that the maintenance plan is based on the distress types, severities, and quantities found during the 2018 PCI survey. As field conditions change, the maintenance plan will become less accurate. Therefore, the maintenance plan will be most useful the sooner it is implemented. Applying maintenance treatments should be an annual event at the airport, and this maintenance plan can serve as a baseline for that work. Guidelines for performing crack sealing and patching techniques are provided in appendix G.

3.2 Major Rehabilitation

In addition to the annual maintenance activities such as crack sealing and patching, some pavements may require more substantial rehabilitation. As a planning aid to the airport, Mn/DOT, and FAA, table 5 provides a summary from MicroPAVER of the predicted 5-year pavement rehabilitation needs at BJL. Although the predicted rehabilitation timeline identifies specific sections and the general timing for the repair, more in-depth project-level studies will be needed to determine exactly how to fix each pavement. Routine maintenance should also be programmed annually throughout the airport, but these efforts should be coordinated with the following rehabilitation recommendations.

The pavement sections identified for major rehabilitation in this report are at or are predicted to reach a condition level where either overlays or reconstruction should be considered. Note that this analysis is based on an unconstrained budget, and these recommendations will need to be adjusted to account for economic and operational considerations. Additionally, identifying projects for work does not guarantee that Federal or State funding will be available to complete the work in the year shown. The airport and Mn/DOT should view these recommendations as viable projects when preparing future Capital Improvement Plans (CIP).

Table 5. Recommended 5-year major rehabilitation plan.

Branch ID	Section ID	Year	Predicted PCI Before Rehab	Estimated Cost
APB	003	2019	48	\$577,754
TLA	001	2019	18	\$532,569
5-year Airport Total				\$1,110,322

3.3 Federal Guidelines

In 1995, Congress mandated that the FAA require, as a condition of grant funding, that airports be prepared to present documentation of a maintenance management program on pavement that has been constructed, reconstructed, or repaired with Federal assistance.

The FAA has defined an acceptable maintenance management program, and this report fulfills many requirements of such a program, including documenting:

- Locations of all runways, taxiways, and aprons.
- Dimensions of the pavement system.
- Types of pavement.
- Year of construction or most recent major rehabilitation.

However, **the airport owner must be an active participant**, specifically by implementing the following actions:

- Annotate pavement areas that have been constructed, reconstructed, or repaired with Federal financial assistance.
- Conduct a "drive-by" inspection at least monthly to detect changes in pavement condition.
- Keep complete records of maintenance activities. Record the date of each "drive-by" inspection and any maintenance performed as a result. Records must be maintained on file for a minimum of 5 years.
- Document detailed inspection information with a history of recorded pavement deterioration by PCI survey (e.g., this report).

An example of a form that can be completed during "drive-by" inspections is provided in appendix G.

This page intentionally left blank.

Appendix A

Sample Unit Maps

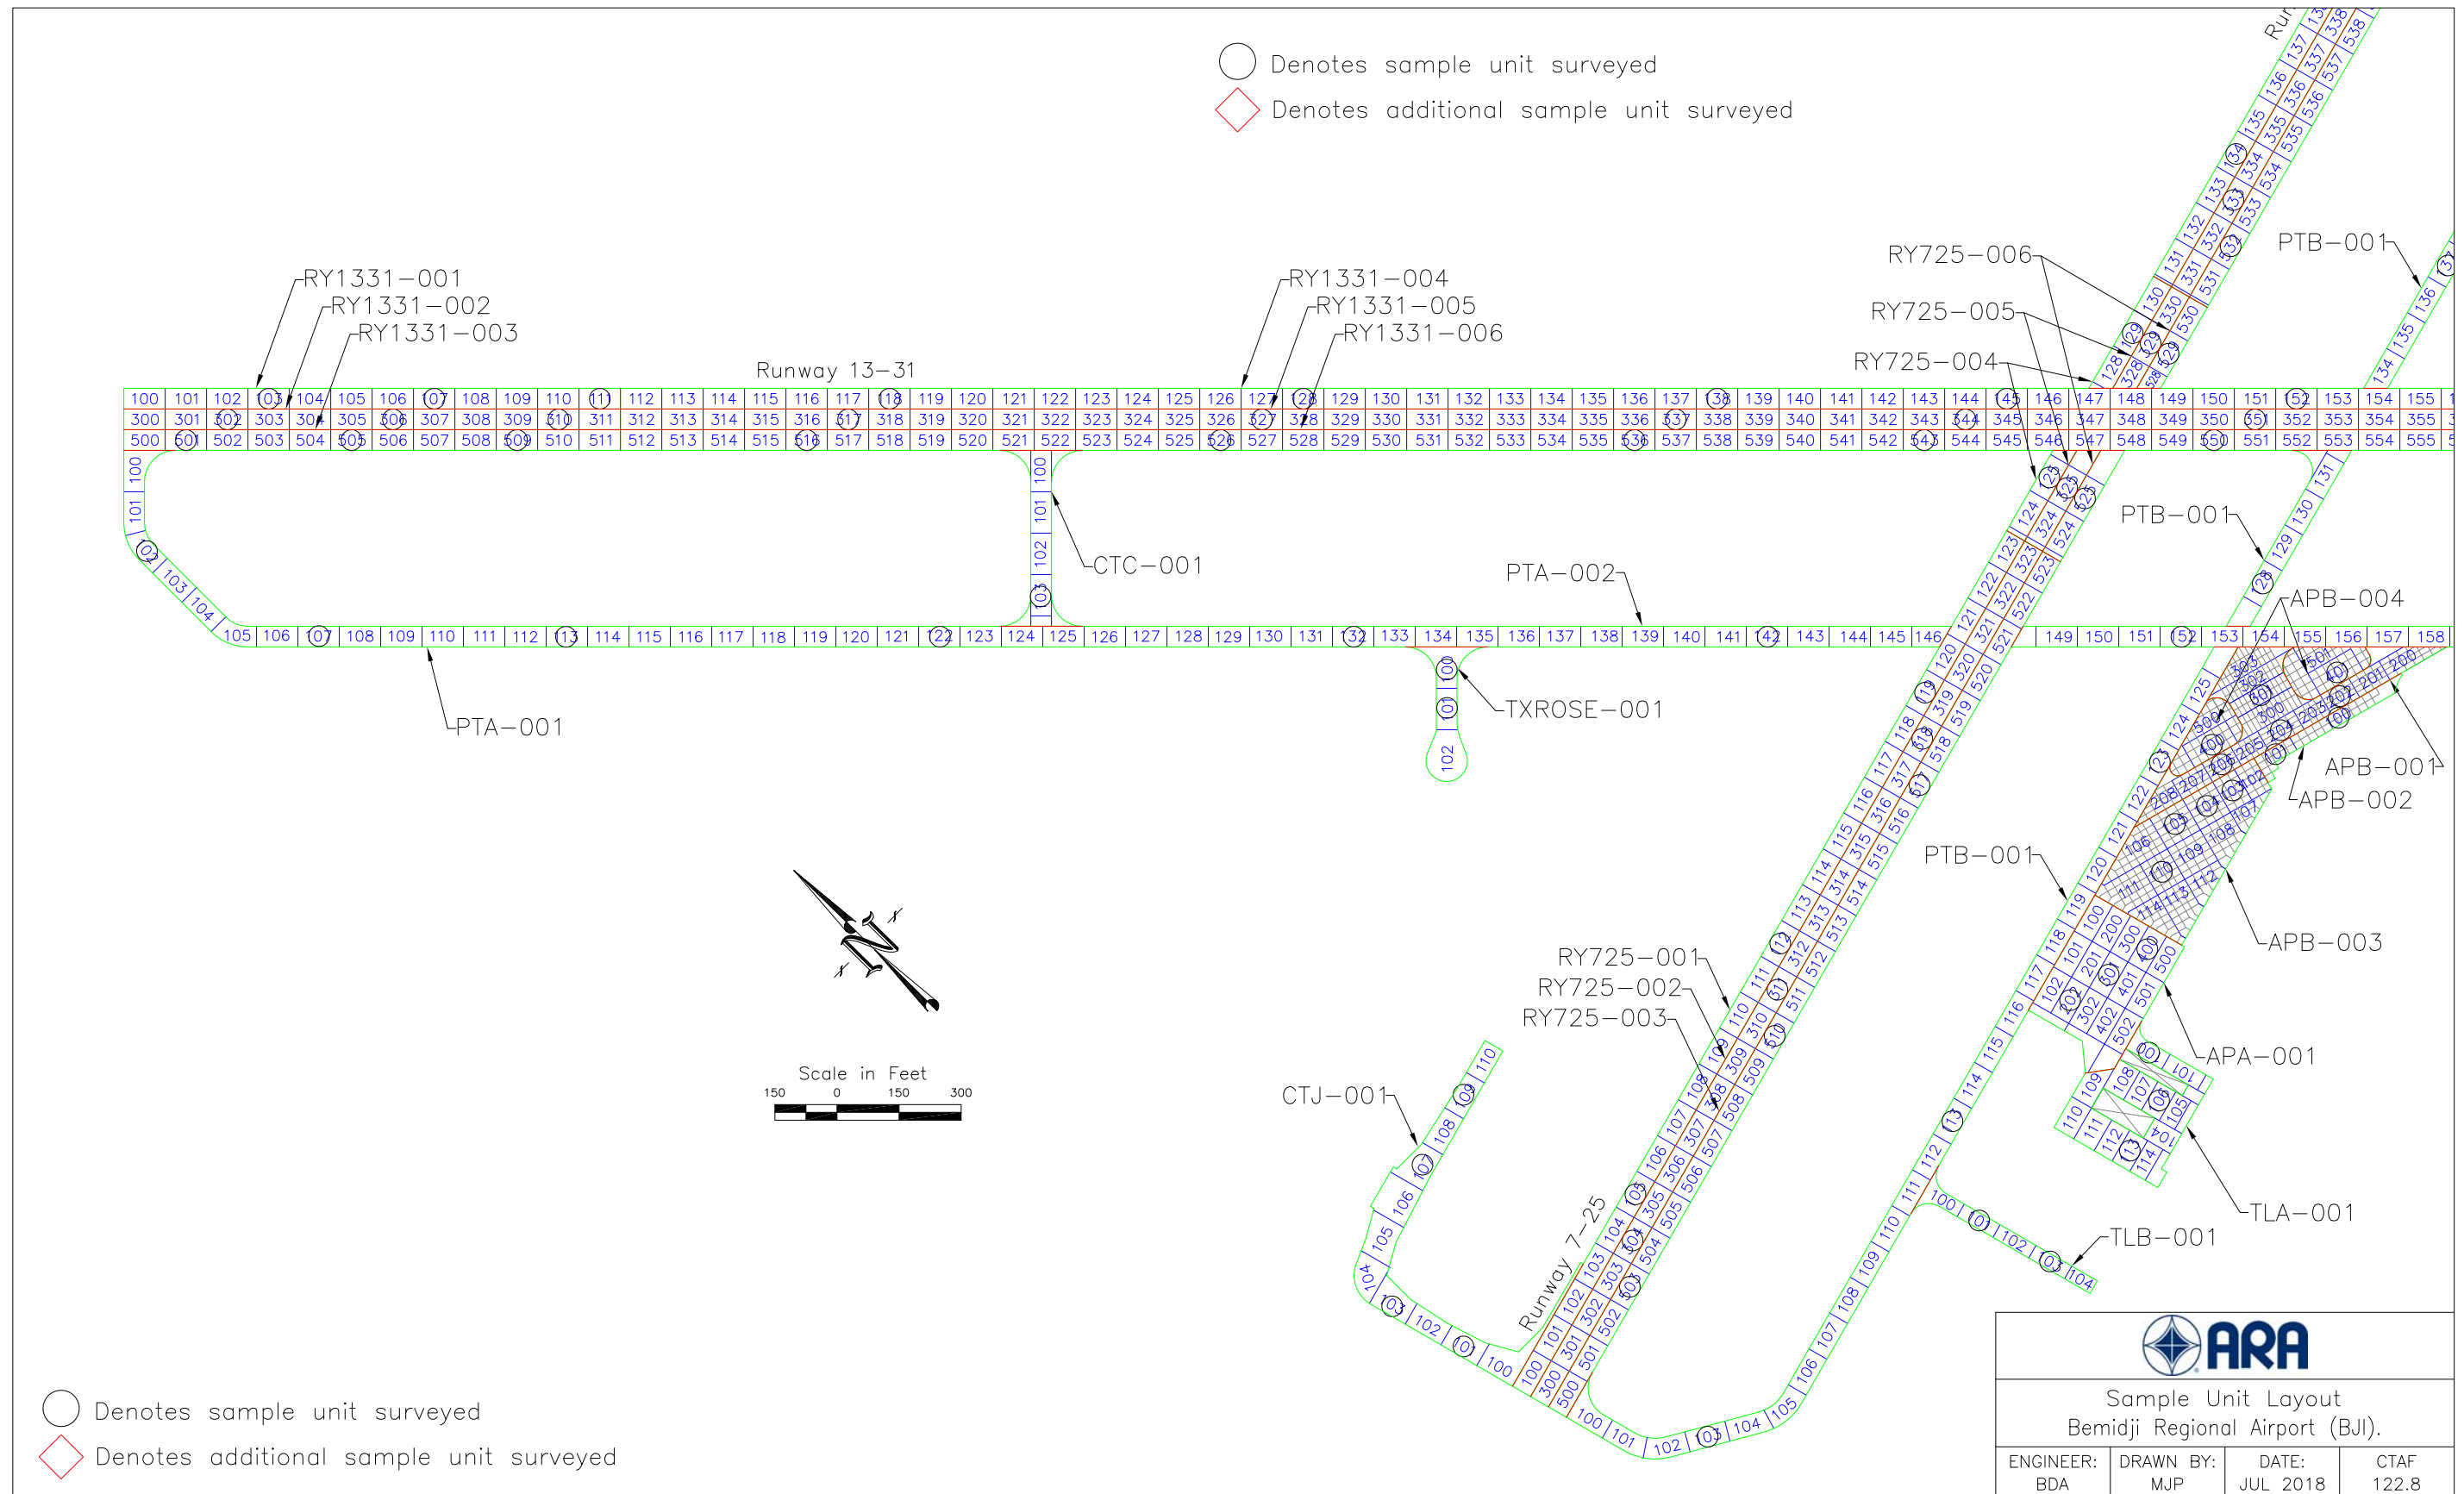


Figure A.1. Sample unit layout map at Bemidji Regional Airport (BJI).



Sample Unit Layout
Bemidji Regional Airport (BJI)

ENGINEER: BDA	DRAWN BY: MJP	DATE: JUL 2018	CTAF 122.8
------------------	------------------	-------------------	---------------

- Denotes sample unit surveyed
- ◇ Denotes additional sample unit surveyed

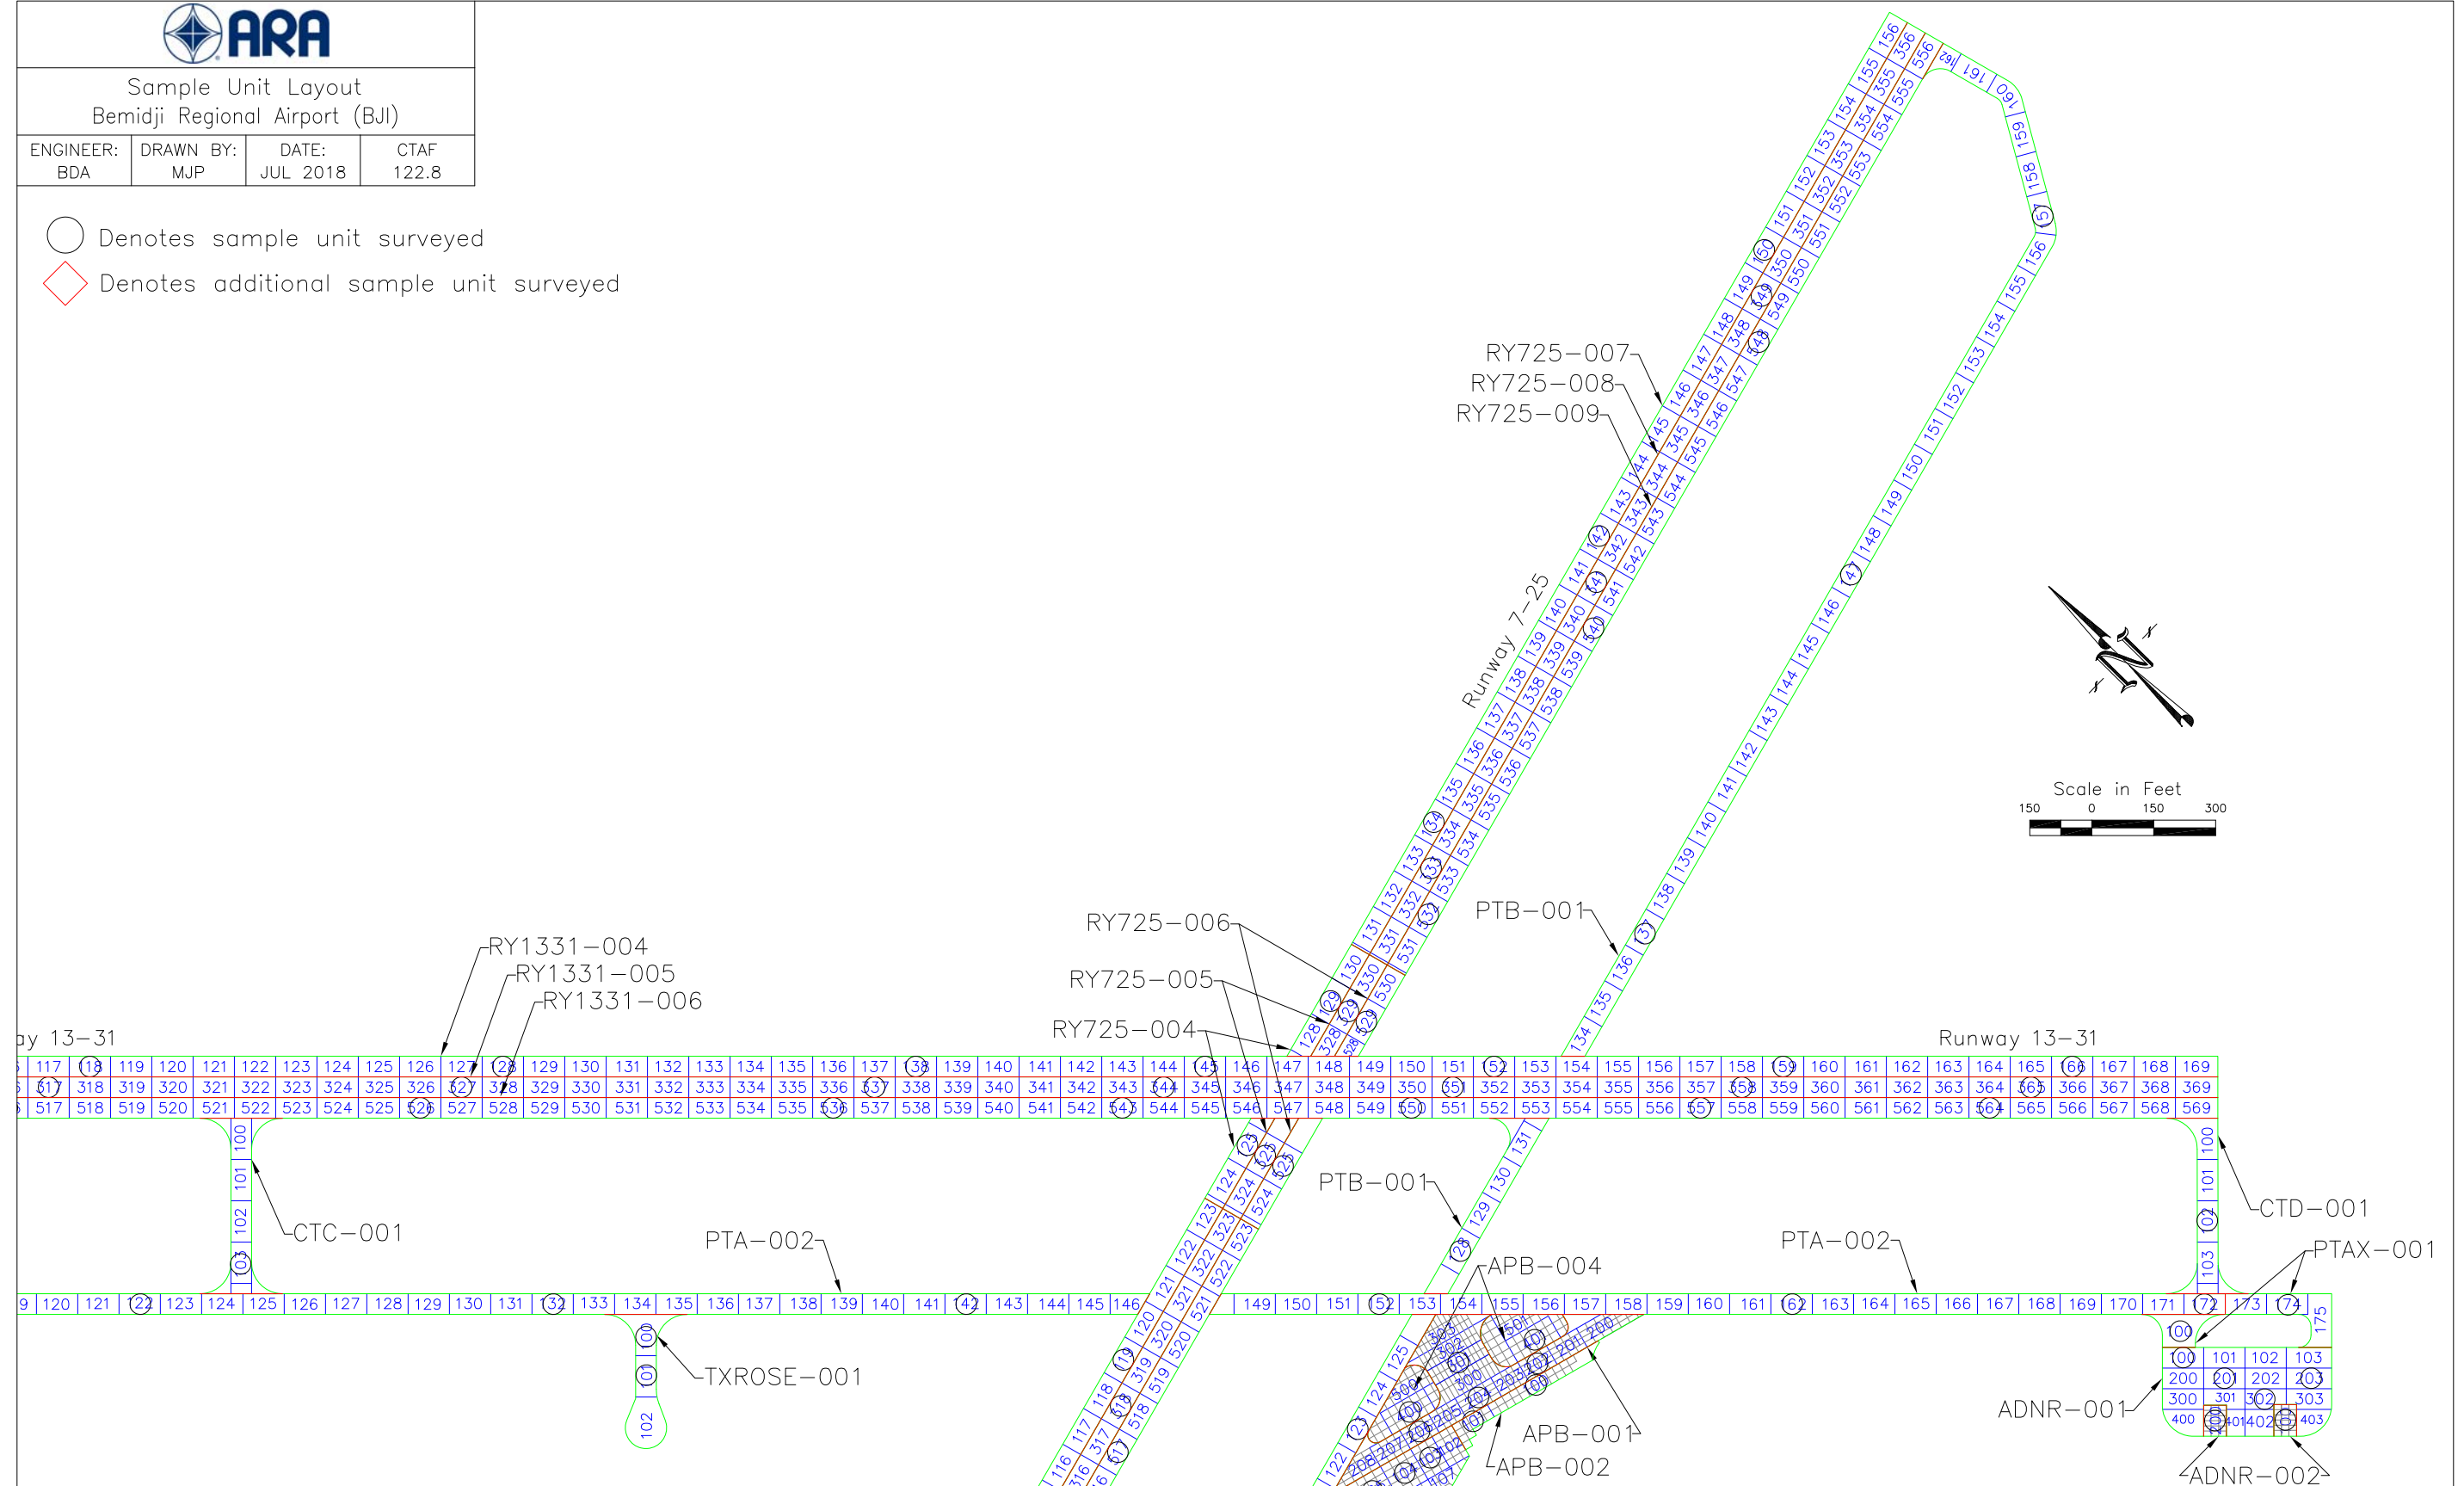


Figure A.2. Sample unit layout map at Bemidji Regional Airport (BJI).

Appendix B
Pictures



BJI ADNR 001 (PCI = 62)



BJI ADNR 002 (PCI = 99)



BJI APA 001 (PCI = 86)



BJI APB 001 (PCI = 94)



BJI APB 003 (PCI = 49)



BJI CTC 001 (PCI = 91)



BJI CTD 001 (PCI = 82)



BJI CTJ 001 (PCI = 100)



BJI PTA 001 (PCI = 93)



BJI PTA 002 (PCI = 88)



BJI PTAX 001 (PCI = 82)



BJI PTB 001 (PCI = 86)



BJI RY1331 001 (PCI = 86)



BJI RY1331 002 (PCI = 77)



BJI RY1331 003 (PCI = 78)



BJI RY1331 004 (PCI = 86)



BJI RY1331 005 (PCI = 79)



BJI RY1331 006 (PCI = 81)



BJI RY725 001 (PCI = 81)



BJI RY725 002 (PCI = 79)



BJI RY725 003 (PCI = 82)



BJI RY725 004 (PCI = 81)



BJI RY725 005 (PCI = 77)



BJI RY725 006 (PCI = 83)



BJI RY725 007 (PCI = 79)



BJI RY725 008 (PCI = 78)



BJI RY725 009 (PCI = 84)



BJI TLA 001 (PCI = 21)



BJI TLB 001 (PCI = 89)



BJI TXRose 001 (PCI = 95)

This page intentionally left blank.

Appendix C

PCI Distress Report

Re-Inspection Report

Network:	BJI	Name:	BEMIDJI						
Branch:	ADNR	Name:	DNR Apron	Use:	APRON	Area:	86,100 SqFt		
Section:	002	of 2	From:	100	To:	200	Last Const.:	7/8/1995	
Surface:	PCC	Family:	MN2018 PCC	Zone:	N	Category:	2	Rank:	S
Area:	8,000 SqFt	Length:	100 Ft	Width:	80 Ft				
Slabs:	36	Slab Length:	13 Ft	Slab Width:	18 Ft	Joint Length:	897 Ft		
Shoulder:		Street Type:		Grade:	0	Lanes:	0		
Last Insp. Date:	7/1/2018	TotalSamples:	2	Surveyed:	2				
Conditions:	PCI: 99								
Sample Number:	100	Type:	R	Area:	18.00 Slabs	PCI:	98		
73	SHRINKAGE CR		N		2.00 Slabs				
Sample Number:	200	Type:	R	Area:	18.00 Slabs	PCI:	100		

<No Distress>

Network:	BJI	Name:	BEMIDJI				
Branch:	ADNR	Name:	DNR Apron	Use:	APRON	Area:	86,100 SqFt
Section:	001	of 2	From:	100	To:	403	Last Const.: 9/1/1995
Surface:	AC	Family:	MN2018 Asphalt Aprons	Zone:	N	Category:	2
Area:	78,100 SqFt	Length:	410 Ft	Width:	210 Ft	Rank:	S
Slabs:	Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft	
Shoulder:	Street Type:		Grade:	0	Lanes:	0	
Last Insp. Date:	7/1/2018	Total Samples:	16	Surveyed:	4		
Conditions:	PCI: 63						
Sample Number:	100	Type:	R	Area:	5000.00 SqFt	PCI:	65
48	L & T CR	L	572.00	Ft			
57	WEATHERING	L	5000.00	SqFt			
48	L & T CR	M	10.00	Ft			
Sample Number:	201	Type:	R	Area:	5000.00 SqFt	PCI:	60
48	L & T CR	M	26.00	Ft			
57	WEATHERING	M	200.00	SqFt			
57	WEATHERING	L	4800.00	SqFt			
48	L & T CR	L	652.00	Ft			
Sample Number:	203	Type:	R	Area:	5600.00 SqFt	PCI:	66
48	L & T CR	L	703.00	Ft			
57	WEATHERING	M	200.00	SqFt			
57	WEATHERING	L	5400.00	SqFt			
Sample Number:	302	Type:	R	Area:	4640.00 SqFt	PCI:	61
57	WEATHERING	L	4440.00	SqFt			
48	L & T CR	L	574.00	Ft			
48	L & T CR	M	11.00	Ft			
57	WEATHERING	M	200.00	SqFt			

Network:	BJI		Name:	BEMIDJI			
Branch:	APA	Name:	APRON A	Use:	APRON	Area:	85,000 SqFt
Section:	001	of 1	From:	100	To:	502	Last Const.: 9/26/2002
Surface:	AAC	Family:	MN2018 Asphalt Aprons	Zone:	N	Category:	2
Area:	85,000 SqFt	Length:	340 Ft	Width:	250 Ft	Rank:	S
Slabs:	Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft	
Shoulder:	Street Type:		Grade:	0	Lanes:	0	
Last Insp. Date:	7/1/2018	Total Samples:	17	Surveyed:	3		
Conditions:	PCI:	86					
Sample Number:	202	Type:	R	Area:	5000.00 SqFt	PCI:	84
48	L & T CR	M	16.00 Ft				
48	L & T CR	L	173.00 Ft				
Sample Number:	301	Type:	R	Area:	4000.00 SqFt	PCI:	93
48	L & T CR	L	74.00 Ft				
Sample Number:	400	Type:	R	Area:	5000.00 SqFt	PCI:	82
48	L & T CR	M	14.00 Ft				
48	L & T CR	L	114.00 Ft				
49	OIL SPILLAGE	N	80.00 SqFt				

Network:	BJI		Name:	BEMIDJI					
Branch:	APB	Name:	APRON B	Use:	APRON	Area:	214,885 SqFt		
Section:	003	of 4	From:	104	To:	116	Last Const.:	9/28/1974	
Surface:	PCC	Family:	MN2018 PCC	Zone:	N	Category:	2	Rank:	P
Area:	93,245 SqFt	Length:	357 Ft	Width:	242 Ft				
Slabs:	274	Slab Length:	20 Ft	Slab Width:	17 Ft	Joint Length:	8,803 Ft		
Shoulder:		Street Type:		Grade:	0	Lanes:	0		
Last Insp. Date:	7/1/2018	Total Samples:	13	Surveyed:	4				
Conditions:	PCI: 49								
Sample Number:	103	Type:	R	Area:	20.00 Slabs	PCI:	51		
67	LARGE PATCH	L		1.00	Slabs				
63	LINEAR CR	M		5.00	Slabs				
73	SHRINKAGE CR	N		1.00	Slabs				
63	LINEAR CR	L		1.00	Slabs				
62	CORNER BREAK	H		1.00	Slabs				
71	FAULTING	L		1.00	Slabs				
Sample Number:	104	Type:	R	Area:	20.00 Slabs	PCI:	55		
63	LINEAR CR	M		4.00	Slabs				
75	CORNER SPALL	H		1.00	Slabs				
63	LINEAR CR	L		3.00	Slabs				
71	FAULTING	L		3.00	Slabs				
73	SHRINKAGE CR	N		2.00	Slabs				
Sample Number:	105	Type:	R	Area:	20.00 Slabs	PCI:	35		
63	LINEAR CR	M		13.00	Slabs				
65	JT SEAL DMG	L		20.00	Slabs				
73	SHRINKAGE CR	N		1.00	Slabs				
72	SHAT. SLAB	M		1.00	Slabs				
74	JOINT SPALL	M		1.00	Slabs				
Sample Number:	110	Type:	R	Area:	20.00 Slabs	PCI:	54		
73	SHRINKAGE CR	N		3.00	Slabs				
72	SHAT. SLAB	M		1.00	Slabs				
63	LINEAR CR	M		5.00	Slabs				
65	JT SEAL DMG	L		20.00	Slabs				

Network:	BJI	Name:	BEMIDJI						
Branch:	APB	Name:	APRON B	Use:	APRON	Area:	214,885 SqFt		
Section:	002	of 4	From:	100	To:	101	Last Const.: 9/28/1974		
Surface:	PCC	Family:	MN2018 PCC	Zone:	N	Category:	2	Rank:	P
Area:	12,900 SqFt	Length:	340 Ft	Width:	35 Ft				
Slabs:	38	Slab Length:	20 Ft	Slab Width:	17 Ft	Joint Length:	920 Ft		
Shoulder:		Street Type:		Grade:	0	Lanes:	0		
Last Insp. Date:	7/1/2018	Total Samples:	2	Surveyed:	2				
Conditions:	PCI: 70								
Sample Number:	100	Type:	R	Area:	25.00 Slabs	PCI:	64		
75	CORNER SPALL	M	2.00	Slabs					
70	SCALING	L	1.00	Slabs					
70	SCALING	M	1.00	Slabs					
66	SMALL PATCH	M	1.00	Slabs					
75	CORNER SPALL	H	2.00	Slabs					
67	LARGE PATCH	L	1.00	Slabs					
63	LINEAR CR	M	2.00	Slabs					
Sample Number:	101	Type:	R	Area:	13.00 Slabs	PCI:	82		
66	SMALL PATCH	L	1.00	Slabs					
67	LARGE PATCH	L	1.00	Slabs					
63	LINEAR CR	L	2.00	Slabs					

Network:	BJI		Name:	BEMIDJI			
Branch:	APB	Name:	APRON B	Use:	APRON	Area:	214,885 SqFt
Section:	001	of 4	From:	200	To:	303	Last Const.: 9/30/1949
Surface:	PCC	Family:	MN2018 PCC	Zone:	N	Category:	2
Area:	72,650 SqFt	Length:	435 Ft	Width:	250 Ft	Rank:	P
Slabs:	291	Slab Length:	20 Ft	Slab Width:	13 Ft	Joint Length:	13,452 Ft
Shoulder:		Street Type:		Grade:	0	Lanes:	0
Last Insp. Date:	7/1/2018	Total Samples:	13	Surveyed:	4		
Conditions:	PCI: 94						
Sample Number:	202	Type:	R	Area:	16.00 Slabs	PCI:	81
65	JT SEAL DMG	L		16.00	Slabs		
74	JOINT SPALL	M		1.00	Slabs		
67	LARGE PATCH	L		4.00	Slabs		
Sample Number:	204	Type:	R	Area:	22.00 Slabs	PCI:	96
75	CORNER SPALL	M		1.00	Slabs		
Sample Number:	206	Type:	R	Area:	16.00 Slabs	PCI:	95
74	JOINT SPALL	M		1.00	Slabs		
Sample Number:	301	Type:	R	Area:	24.00 Slabs	PCI:	100

<No Distress>

Network:	BJI	Name:	BEMIDJI						
Branch:	APB	Name:	APRON B	Use:	APRON	Area:	214,885 SqFt		
Section:	004	of 4	From:	400	To:	401	Last Const.:	9/30/1989	
Surface:	PCC	Family:	MN2018 PCC	Zone:	N	Category:	2	Rank:	P
Area:	36,090 SqFt	Length:	400 Ft	Width:	125 Ft				
Slabs:	90	Slab Length:	20 Ft	Slab Width:	20 Ft	Joint Length:	4,475 Ft		
Shoulder:		Street Type:		Grade:	0	Lanes:	0		
Last Insp. Date:	7/1/2018	Total Samples:	5	Surveyed:	2				
Conditions:	PCI: 81								
Sample Number:	400	Type:	R	Area:	18.00 Slabs	PCI:	64		
74	JOINT SPALL		H	3.00	Slabs				
65	JT SEAL DMG		M	18.00	Slabs				
74	JOINT SPALL		M	1.00	Slabs				
Sample Number:	401	Type:	R	Area:	18.00 Slabs	PCI:	98		
65	JT SEAL DMG		L	18.00	Slabs				

Network:	BJI	Name:	BEMIDJI				
Branch:	CTC	Name:	Connector Taxiway C	Use:	TAXIWAY	Area:	23,350 SqFt
Section:	001	of 1	From:	100	To:	103	Last Const.: 9/1/2008
Surface:	AC	Family:	MN2018 Asphalt Runway- Taxiways	Zone:	N	Category:	2 Rank: S
Area:	23,350 SqFt	Length:	425 Ft	Width:	50 Ft		
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft
Shoulder:		Street Type:		Grade:	0	Lanes:	0
Last Insp. Date:	7/1/2018	TotalSamples:	4	Surveyed:	1		
Conditions:	PCI: 91						
Sample Number:	103	Type:	R	Area:	5000.00 SqFt	PCI:	91
48	L & T CR		M	5.00 Ft			
48	L & T CR		L	62.00 Ft			

Network:	BJI	Name:	BEMIDJI				
Branch:	CTD	Name:	Connector Taxiway D	Use:	TAXIWAY	Area:	22,300 SqFt
Section:	001	of 1	From:	100	To:	103	Last Const.: 9/1/2008
Surface:	AC	Family:	MN2018 Asphalt Runway- Taxiways	Zone:	N	Category:	2 Rank: P
Area:	22,300 SqFt	Length:	425 Ft	Width:	50 Ft		
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft
Shoulder:		Street Type:		Grade:	0	Lanes:	0
Last Insp. Date:	7/1/2018	TotalSamples:	4	Surveyed:	1		
Conditions:	PCI: 82						
Sample Number:	102	Type:	R	Area:	5000.00 SqFt	PCI:	82
48	L & T CR	M		7.00 Ft			
48	L & T CR	L		184.00 Ft			
57	WEATHERING	L		800.00 SqFt			

Network:	BJI	Name:	BEMIDJI				
Branch:	CTJ	Name:	Connection Taxiway J	Use:	TAXIWAY	Area:	73,300 SqFt
Section:	001	of 1	From:	A	To:	B	Last Const.: 1/15/2018
Surface:	AC	Family:	MN2018 Asphalt Runway- Taxiways	Zone:		Category:	Rank: P
Area:	73,300 SqFt	Length:	1,050 Ft	Width:	50 Ft		
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft
Shoulder:		Street Type:		Grade:	0	Lanes:	0
Last Insp. Date:	7/1/2018	TotalSamples:	9	Surveyed:	4		
Conditions:	PCI: 100						
Sample Number:	101	Type:	R	Area:	5000.00 SqFt	PCI:	100
<No Distress>							
Sample Number:	103	Type:	R	Area:	5000.00 SqFt	PCI:	100
<No Distress>							
Sample Number:	107	Type:	R	Area:	5000.00 SqFt	PCI:	100
<No Distress>							
Sample Number:	109	Type:	R	Area:	5000.00 SqFt	PCI:	100
<No Distress>							

Network:	BJI		Name:	BEMIDJI		
Branch:	PTA	Name:	PARALLEL TAXIWAY A	Use:	TAXIWAY	Area: 355,525 SqFt
Section:	002	of 2	From: 115	To: 179	Last Const.: 9/25/2006	
Surface:	AC	Family: MN2018 Asphalt Runway- Taxiways	Zone: N	Category: 2	Rank: P	
Area:	280,000 SqFt	Length:	5,600 Ft	Width:	50 Ft	
Slabs:	Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft
Shoulder:	Street Type:	Grade: 0	Lanes: 0			
Last Insp. Date:	7/1/2018	TotalSamples:	57	Surveyed:	6	
Conditions:	PCI: 88					
Sample Number:	122	Type:	R	Area:	5000.00 SqFt	PCI: 88
48	L & T CR	L		108.00	Ft	
48	L & T CR	M		2.00	Ft	
Sample Number:	132	Type:	R	Area:	5000.00 SqFt	PCI: 91
48	L & T CR	L		139.00	Ft	
Sample Number:	142	Type:	R	Area:	5000.00 SqFt	PCI: 89
48	L & T CR	L		175.00	Ft	
Sample Number:	152	Type:	R	Area:	5000.00 SqFt	PCI: 91
48	L & T CR	L		136.00	Ft	
Sample Number:	162	Type:	R	Area:	5000.00 SqFt	PCI: 85
48	L & T CR	L		171.00	Ft	
48	L & T CR	M		2.00	Ft	
Sample Number:	172	Type:	R	Area:	5000.00 SqFt	PCI: 83
48	L & T CR	L		309.00	Ft	

Network:	BJI		Name:	BEMIDJI		
Branch:	PTA	Name:	PARALLEL TAXIWAY A	Use:	TAXIWAY	Area: 355,525 SqFt
Section:	001	of 2	From: 100	To: 115	Last Const.: 9/1/2008	
Surface:	AC	Family:	MN2018 Asphalt Runway- Taxiways	Zone: N	Category: 2	Rank: P
Area:	75,525 SqFt	Length:	1,500 Ft	Width:	50 Ft	
Slabs:	Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft
Shoulder:	Street Type:	Grade:	0	Lanes:	0	
Last Insp. Date:	7/1/2018	TotalSamples:	15	Surveyed:	3	
Conditions:	PCI: 93					
Sample Number:	102	Type:	R	Area:	5000.00 SqFt	PCI: 90
57	WEATHERING	L		400.00	SqFt	
48	L & T CR	L		122.00	Ft	
Sample Number:	107	Type:	R	Area:	5000.00 SqFt	PCI: 93
48	L & T CR	L		93.00	Ft	
Sample Number:	113	Type:	R	Area:	5000.00 SqFt	PCI: 95
48	L & T CR	L		52.00	Ft	

Network:	BJI	Name:	BEMIDJI				
Branch:	PTAX	Name:	PTA extended	Use:	TAXIWAY	Area:	24,950 SqFt
Section:	001	of 1	From:	100	To:	175	Last Const.: 9/1/2006
Surface:	AC	Family:	MN2018 Asphalt Runway- Taxiways	Zone:	N	Category:	2 Rank: S
Area:	24,950 SqFt	Length:	425 Ft	Width:	50 Ft		
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft
Shoulder:		Street Type:		Grade:	0	Lanes:	0
Last Insp. Date:	7/1/2018	TotalSamples:	4	Surveyed:	2		
Conditions:	PCI: 82						
Sample Number:	100	Type:	R	Area:	7550.00 SqFt	PCI:	78
48	L & T CR		L	341.00 Ft			
57	WEATHERING		L	3000.00 SqFt			
48	L & T CR		M	8.00 Ft			
Sample Number:	174	Type:	R	Area:	5000.00 SqFt	PCI:	89
48	L & T CR		L	98.00 Ft			
48	L & T CR		M	2.00 Ft			

Network:	BJI	Name:		BEMIDJI		
Branch:	PTB	Name:	PARALLEL TAXIWAY B	Use:	TAXIWAY	Area: 302,050 SqFt
Section:	001	of 1	From: 100	To: 162+50	Last Const.: 9/25/2006	
Surface:	AC	Family: MN2018 Asphalt Runway- Taxiways	Zone: N	Category: 2	Rank: S	
Area:	302,050 SqFt	Length:	6,250 Ft	Width:	50 Ft	
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length: Ft
Shoulder:		Street Type:		Grade: 0	Lanes: 0	
Last Insp. Date:	7/1/2018	TotalSamples:	61	Surveyed:	7	
Conditions:	PCI: 86					
Sample Number:	103	Type:	R	Area:	5000.00 SqFt	PCI: 81
48	L & T CR		L	116.00	Ft	
48	L & T CR		M	75.00	Ft	
Sample Number:	113	Type:	R	Area:	5000.00 SqFt	PCI: 79
48	L & T CR		L	278.00	Ft	
48	L & T CR		M	22.00	Ft	
Sample Number:	123	Type:	R	Area:	5000.00 SqFt	PCI: 86
48	L & T CR		M	28.00	Ft	
48	L & T CR		L	122.00	Ft	
Sample Number:	128	Type:	R	Area:	5000.00 SqFt	PCI: 88
48	L & T CR		L	179.00	Ft	
Sample Number:	137	Type:	R	Area:	5000.00 SqFt	PCI: 91
48	L & T CR		L	125.00	Ft	
Sample Number:	147	Type:	R	Area:	5000.00 SqFt	PCI: 91
48	L & T CR		L	132.00	Ft	
Sample Number:	157	Type:	R	Area:	5000.00 SqFt	PCI: 81
48	L & T CR		L	353.00	Ft	

Network:	BJI		Name:	BEMIDJI					
Branch:	RY1331	Name:	RUNWAY 13-31	Use:	RUNWAY	Area:	1,050,000 SqFt		
Section:	006	of 6	From:	512	To:	569	Last Const.:	9/1/2008	
Surface:	AC	Family:	MN2018 Asphalt Runway- Taxiways	Zone:	N	Category:	2	Rank:	P
Area:	290,000 SqFt	Length:	5,800 Ft	Width:	50 Ft				
Slabs:	Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft			
Shoulder:	Street Type:	Grade:	0	Lanes:	0				
Last Insp. Date:	7/1/2018	TotalSamples:	58	Surveyed:	7				
Conditions:	PCI: 81								
Sample Number:	516	Type:	R	Area:	5000.00 SqFt	PCI:	80		
57	WEATHERING	L		2000.00	SqFt				
48	L & T CR	L		274.00	Ft				
Sample Number:	526	Type:	R	Area:	5000.00 SqFt	PCI:	75		
48	L & T CR	L		276.00	Ft				
57	WEATHERING	L		2000.00	SqFt				
48	L & T CR	M		9.00	Ft				
Sample Number:	536	Type:	R	Area:	5000.00 SqFt	PCI:	81		
48	L & T CR	L		148.00	Ft				
48	L & T CR	M		13.00	Ft				
57	WEATHERING	L		2000.00	SqFt				
Sample Number:	543	Type:	R	Area:	5000.00 SqFt	PCI:	83		
48	L & T CR	L		62.00	Ft				
57	WEATHERING	L		2000.00	SqFt				
48	L & T CR	M		20.00	Ft				
Sample Number:	550	Type:	R	Area:	5000.00 SqFt	PCI:	87		
57	WEATHERING	L		2000.00	SqFt				
48	L & T CR	L		125.00	Ft				
Sample Number:	557	Type:	R	Area:	5000.00 SqFt	PCI:	88		
48	L & T CR	L		101.00	Ft				
57	WEATHERING	L		2000.00	SqFt				
Sample Number:	564	Type:	R	Area:	5000.00 SqFt	PCI:	76		
57	WEATHERING	L		2000.00	SqFt				
48	L & T CR	M		1.00	Ft				
48	L & T CR	L		263.00	Ft				

Network:	BJI		Name:	BEMIDJI					
Branch:	RY1331	Name:	RUNWAY 13-31	Use:	RUNWAY	Area:	1,050,000 SqFt		
Section:	005	of 6	From:	312	To:	369	Last Const.:	9/1/2008	
Surface:	AC	Family:	MN2018 Asphalt Runway- Taxiways	Zone:	N	Category:	2	Rank:	P
Area:	290,000 SqFt	Length:	5,800 Ft	Width:	50 Ft	Joint Length:	Ft		
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft		
Shoulder:		Street Type:		Grade:	0	Lanes:	0		
Last Insp. Date:	7/1/2018	TotalSamples:	58	Surveyed:	7				
Conditions:	PCI: 79								
Sample Number:	317	Type:	R	Area:	5000.00 SqFt	PCI:	80		
57	WEATHERING	L		2000.00	SqFt				
48	L & T CR	L		282.00	Ft				
Sample Number:	327	Type:	R	Area:	5000.00 SqFt	PCI:	80		
57	WEATHERING	L		2000.00	SqFt				
48	L & T CR	L		276.00	Ft				
Sample Number:	337	Type:	R	Area:	5000.00 SqFt	PCI:	78		
48	L & T CR	M		12.00	Ft				
57	WEATHERING	L		2000.00	SqFt				
48	L & T CR	L		201.00	Ft				
Sample Number:	344	Type:	R	Area:	5000.00 SqFt	PCI:	76		
48	L & T CR	L		242.00	Ft				
57	WEATHERING	L		2000.00	SqFt				
48	L & T CR	M		14.00	Ft				
Sample Number:	351	Type:	R	Area:	5000.00 SqFt	PCI:	80		
48	L & T CR	L		282.00	Ft				
57	WEATHERING	L		2000.00	SqFt				
Sample Number:	358	Type:	R	Area:	5000.00 SqFt	PCI:	81		
57	WEATHERING	L		2000.00	SqFt				
48	L & T CR	L		253.00	Ft				
Sample Number:	365	Type:	R	Area:	5000.00 SqFt	PCI:	80		
48	L & T CR	L		267.00	Ft				
57	WEATHERING	L		2000.00	SqFt				

Network:	BJI	Name:	BEMIDJI						
Branch:	RY1331	Name:	RUNWAY 13-31	Use:	RUNWAY	Area:	1,050,000 SqFt		
Section:	004	of 6	From:	112	To:	169	Last Const.:	9/1/2008	
Surface:	AC	Family:	MN2018 Asphalt Runway- Taxiways	Zone:	N	Category:	2	Rank:	P
Area:	290,000 SqFt	Length:	5,800 Ft	Width:	50 Ft				
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft		
Shoulder:		Street Type:		Grade:	0	Lanes:	0		
Last Insp. Date:	7/1/2018	TotalSamples:	58	Surveyed:	7				
Conditions:	PCI: 86								
Sample Number:	118	Type:	R	Area:	5000.00 SqFt	PCI:	76		
48	L & T CR	M		2.00 Ft					
57	WEATHERING	L		2000.00 SqFt					
48	L & T CR	L		278.00 Ft					
Sample Number:	128	Type:	R	Area:	5000.00 SqFt	PCI:	90		
57	WEATHERING	L		2000.00 SqFt					
48	L & T CR	L		67.00 Ft					
Sample Number:	138	Type:	R	Area:	5000.00 SqFt	PCI:	89		
48	L & T CR	L		81.00 Ft					
57	WEATHERING	L		2000.00 SqFt					
Sample Number:	145	Type:	R	Area:	5000.00 SqFt	PCI:	89		
57	WEATHERING	L		2000.00 SqFt					
48	L & T CR	L		86.00 Ft					
Sample Number:	152	Type:	R	Area:	5000.00 SqFt	PCI:	86		
48	L & T CR	L		151.00 Ft					
57	WEATHERING	L		2000.00 SqFt					
Sample Number:	159	Type:	R	Area:	5000.00 SqFt	PCI:	88		
57	WEATHERING	L		2000.00 SqFt					
48	L & T CR	L		104.00 Ft					
Sample Number:	166	Type:	R	Area:	5000.00 SqFt	PCI:	86		
57	WEATHERING	L		2000.00 SqFt					
48	L & T CR	L		146.00 Ft					

Network:	BJI		Name:	BEMIDJI					
Branch:	RY1331	Name:	RUNWAY 13-31	Use:	RUNWAY	Area:	1,050,000 SqFt		
Section:	002	of 6	From:	300	To:	311	Last Const.:	9/1/2008	
Surface:	AC	Family:	MN2018 Asphalt Runway- Taxiways	Zone:	N	Category:	2	Rank:	P
Area:	60,000 SqFt	Length:	1,200 Ft	Width:	50 Ft	Joint Length:	Ft		
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft		
Shoulder:		Street Type:		Grade:	0	Lanes:	0		
Last Insp. Date:	7/1/2018	TotalSamples:	12	Surveyed:	3				
Conditions:	PCI: 77								
Sample Number:	302	Type:	R	Area:	5000.00 SqFt	PCI:	74		
48	L & T CR	M		4.00 Ft					
57	WEATHERING	L		2000.00 SqFt					
48	L & T CR	L		334.00 Ft					
Sample Number:	306	Type:	R	Area:	5000.00 SqFt	PCI:	81		
57	WEATHERING	L		2000.00 SqFt					
48	L & T CR	L		258.00 Ft					
Sample Number:	310	Type:	R	Area:	5000.00 SqFt	PCI:	77		
48	L & T CR	L		239.00 Ft					
48	L & T CR	M		2.00 Ft					
57	WEATHERING	L		2000.00 SqFt					

Network:	BJI	Name:	BEMIDJI						
Branch:	RY1331	Name:	RUNWAY 13-31	Use:	RUNWAY	Area:	1,050,000 SqFt		
Section:	003	of 6	From:	500	To:	511	Last Const.:	9/1/2008	
Surface:	AC	Family:	MN2018 Asphalt Runway- Taxiways	Zone:	N	Category:	2	Rank:	P
Area:	60,000 SqFt	Length:	1,200 Ft	Width:	50 Ft				
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft		
Shoulder:		Street Type:		Grade:	0	Lanes:	0		
Last Insp. Date:	7/1/2018	TotalSamples:	12	Surveyed:	3				
Conditions:	PCI: 78								
Sample Number:	501	Type:	R	Area:	5000.00 SqFt	PCI:	82		
48	L & T CR	L		147.00 Ft					
48	L & T CR	M		2.00 Ft					
57	WEATHERING	L		2000.00 SqFt					
Sample Number:	505	Type:	R	Area:	5000.00 SqFt	PCI:	77		
57	WEATHERING	L		2000.00 SqFt					
48	L & T CR	L		225.00 Ft					
48	L & T CR	M		16.00 Ft					
Sample Number:	509	Type:	R	Area:	5000.00 SqFt	PCI:	75		
48	L & T CR	L		263.00 Ft					
48	L & T CR	M		12.00 Ft					
57	WEATHERING	L		2000.00 SqFt					

Network:	BJI		Name:	BEMIDJI					
Branch:	RY1331	Name:	RUNWAY 13-31	Use:	RUNWAY	Area:	1,050,000 SqFt		
Section:	001	of 6	From:	100	To:	111	Last Const.:	9/1/2008	
Surface:	AC	Family:	MN2018 Asphalt Runway- Taxiways	Zone:	N	Category:	2	Rank:	P
Area:	60,000 SqFt	Length:	1,200 Ft	Width:	50 Ft				
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft		
Shoulder:		Street Type:		Grade:	0	Lanes:	0		
Last Insp. Date:	7/1/2018	TotalSamples:	12	Surveyed:	3				
Conditions:	PCI: 86								
Sample Number:	103	Type:	R	Area:	5000.00 SqFt	PCI:	92		
57	WEATHERING	L		2000.00	SqFt				
48	L & T CR	L		21.00	Ft				
Sample Number:	107	Type:	R	Area:	5000.00 SqFt	PCI:	82		
48	L & T CR	M		27.00	Ft				
57	WEATHERING	L		2000.00	SqFt				
48	L & T CR	L		91.00	Ft				
Sample Number:	111	Type:	R	Area:	5000.00 SqFt	PCI:	85		
48	L & T CR	M		10.00	Ft				
48	L & T CR	L		58.00	Ft				
57	WEATHERING	L		2000.00	SqFt				

Network:	BJI		Name:	BEMIDJI					
Branch:	RY725	Name:	RUNWAY 7-25	Use:	RUNWAY	Area:	829,350 SqFt		
Section:	005	of 9	From:	324+48	To:	330+26	Last Const.:	9/25/2008	
Surface:	AC	Family:	MN2018 Asphalt Runway- Taxiways	Zone:	N	Category:	2	Rank:	P
Area:	26,800 SqFt	Length:	536 Ft	Width:	50 Ft				
Slabs:	Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft			
Shoulder:	Street Type:	Grade:	0	Lanes:	0				
Last Insp. Date:	7/1/2018	TotalSamples:	5	Surveyed:	2				
Conditions:	PCI: 77								
Sample Number:	325	Type:	R	Area:	5000.00 SqFt	PCI:	75		
48	L & T CR	L		267.00 Ft					
57	WEATHERING	L		2000.00 SqFt					
48	L & T CR	M		28.00 Ft					
Sample Number:	329	Type:	R	Area:	5000.00 SqFt	PCI:	78		
48	L & T CR	L		313.00 Ft					
57	WEATHERING	L		2000.00 SqFt					

Network:	BJI		Name:	BEMIDJI					
Branch:	RY725	Name:	RUNWAY 7-25	Use:	RUNWAY	Area:	829,350 SqFt		
Section:	002	of 9	From:	300	To:	324+48	Last Const.:	9/25/2006	
Surface:	AC	Family:	MN2018 Asphalt Runway- Taxiways	Zone:	N	Category:	2	Rank:	P
Area:	119,150 SqFt	Length:	2,383 Ft	Width:	50 Ft	Joint Length:	Ft		
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft		
Shoulder:		Street Type:		Grade:	0	Lanes:	0		
Last Insp. Date:	7/1/2018	TotalSamples:	24	Surveyed:	3				
Conditions:	PCI: 79								
Sample Number:	304	Type:	R	Area:	5000.00 SqFt	PCI:	77		
48	L & T CR	M		4.00 Ft					
57	WEATHERING	L		2000.00 SqFt					
48	L & T CR	L		247.00 Ft					
Sample Number:	311	Type:	R	Area:	5000.00 SqFt	PCI:	80		
57	WEATHERING	L		2000.00 SqFt					
48	L & T CR	L		261.00 Ft					
Sample Number:	318	Type:	R	Area:	5000.00 SqFt	PCI:	80		
48	L & T CR	M		8.00 Ft					
48	L & T CR	L		182.00 Ft					
57	WEATHERING	L		2000.00 SqFt					

Network:	BJI	Name:	BEMIDJI						
Branch:	RY725	Name:	RUNWAY 7-25	Use:	RUNWAY	Area:	829,350 SqFt		
Section:	004	of 9	From:	124+48	To:	130+26	Last Const.: 9/25/2008		
Surface:	AC	Family:	MN2018 Asphalt Runway- Taxiways	Zone:	N	Category:	2	Rank:	P
Area:	26,800 SqFt	Length:	536 Ft	Width:	50 Ft				
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft		
Shoulder:		Street Type:		Grade:	0	Lanes:	0		
Last Insp. Date:	7/1/2018	TotalSamples:	5	Surveyed:	2				
Conditions:	PCI: 81								
Sample Number:	125	Type:	R	Area:	5000.00 SqFt	PCI:	86		
57	WEATHERING	L		2000.00 SqFt					
48	L & T CR	M		8.00 Ft					
48	L & T CR	L		43.00 Ft					
Sample Number:	129	Type:	R	Area:	5000.00 SqFt	PCI:	76		
48	L & T CR	L		72.00 Ft					
48	L & T CR	M		85.00 Ft					
57	WEATHERING	L		2000.00 SqFt					

Network:	BJI		Name:	BEMIDJI					
Branch:	RY725	Name:	RUNWAY 7-25	Use:	RUNWAY	Area:	829,350 SqFt		
Section:	003	of 9	From:	500	To:	524+48	Last Const.:	9/25/2006	
Surface:	AC	Family:	MN2018 Asphalt Runway- Taxiways	Zone:	N	Category:	2	Rank:	P
Area:	119,150 SqFt	Length:	2,383 Ft	Width:	50 Ft	Joint Length:	Ft		
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft		
Shoulder:		Street Type:		Grade:	0	Lanes:	0		
Last Insp. Date:	7/1/2018	TotalSamples:	24	Surveyed:	3				
Conditions:	PCI: 82								
Sample Number:	503	Type:	R	Area:	5000.00 SqFt	PCI:	84		
57	WEATHERING	L		2000.00	SqFt				
48	L & T CR	L		187.00	Ft				
Sample Number:	510	Type:	R	Area:	5000.00 SqFt	PCI:	85		
48	L & T CR	L		162.00	Ft				
57	WEATHERING	L		2000.00	SqFt				
Sample Number:	517	Type:	R	Area:	5000.00 SqFt	PCI:	77		
57	WEATHERING	L		2000.00	SqFt				
48	L & T CR	L		237.00	Ft				
48	L & T CR	M		7.00	Ft				

Network:	BJI		Name:	BEMIDJI					
Branch:	RY725	Name:	RUNWAY 7-25	Use:	RUNWAY	Area:	829,350 SqFt		
Section:	001	of 9	From:	100	To:	124+48	Last Const.:	9/25/2006	
Surface:	AC	Family:	MN2018 Asphalt Runway- Taxiways	Zone:	N	Category:	2	Rank:	P
Area:	119,150 SqFt	Length:	2,383 Ft	Width:	50 Ft				
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft		
Shoulder:		Street Type:		Grade:	0	Lanes:	0		
Last Insp. Date:	7/1/2018	TotalSamples:	24	Surveyed:	3				
Conditions:	PCI: 81								
Sample Number:	105	Type:	R	Area:	5000.00 SqFt	PCI:	86		
57	WEATHERING	L		2000.00	SqFt				
48	L & T CR	L		146.00	Ft				
Sample Number:	112	Type:	R	Area:	5000.00 SqFt	PCI:	82		
57	WEATHERING	L		2000.00	SqFt				
48	L & T CR	L		226.00	Ft				
Sample Number:	119	Type:	R	Area:	5000.00 SqFt	PCI:	76		
48	L & T CR	L		246.00	Ft				
57	WEATHERING	L		2000.00	SqFt				
48	L & T CR	M		18.00	Ft				

Network:	BJI		Name:	BEMIDJI					
Branch:	RY725	Name:	RUNWAY 7-25	Use:	RUNWAY	Area:	829,350 SqFt		
Section:	008	of 9	From:	330+26	To:	356	Last Const.:	9/25/2006	
Surface:	AC	Family:	MN2018 Asphalt Runway- Taxiways	Zone:	N	Category:	2	Rank:	P
Area:	130,500 SqFt	Length:	2,610 Ft	Width:	50 Ft	Joint Length:	Ft		
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft		
Shoulder:		Street Type:		Grade:	0	Lanes:	0		
Last Insp. Date:	7/1/2018	TotalSamples:	26	Surveyed:	3				
Conditions:	PCI: 78								
Sample Number:	333	Type:	R	Area:	5000.00 SqFt	PCI:	75		
48	L & T CR	M		7.00 Ft					
48	L & T CR	L		281.00 Ft					
57	WEATHERING	L		2000.00 SqFt					
Sample Number:	341	Type:	R	Area:	5000.00 SqFt	PCI:	76		
48	L & T CR	L		375.00 Ft					
57	WEATHERING	L		2000.00 SqFt					
Sample Number:	349	Type:	R	Area:	5000.00 SqFt	PCI:	81		
48	L & T CR	L		156.00 Ft					
48	L & T CR	M		6.00 Ft					
57	WEATHERING	L		2000.00 SqFt					

Network:	BJI		Name:	BEMIDJI					
Branch:	RY725	Name:	RUNWAY 7-25	Use:	RUNWAY	Area:	829,350 SqFt		
Section:	006	of 9	From:	524+48	To:	530+26	Last Const.:	9/25/2008	
Surface:	AC	Family:	MN2018 Asphalt Runway- Taxiways	Zone:	N	Category:	2	Rank:	P
Area:	26,800 SqFt	Length:	536 Ft	Width:	50 Ft				
Slabs:	Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft			
Shoulder:	Street Type:	Grade:	0	Lanes:	0				
Last Insp. Date:	7/1/2018	TotalSamples:	6	Surveyed:	2				
Conditions:	PCI: 83								
Sample Number:	525	Type:	R	Area:	5000.00 SqFt	PCI:	83		
57	WEATHERING	L		2000.00	SqFt				
48	L & T CR	L		27.00	Ft				
48	L & T CR	M		34.00	Ft				
Sample Number:	529	Type:	R	Area:	5000.00 SqFt	PCI:	82		
48	L & T CR	L		124.00	Ft				
57	WEATHERING	L		2000.00	SqFt				
48	L & T CR	M		16.00	Ft				

Network:	BJI	Name:	BEMIDJI						
Branch:	RY725	Name:	RUNWAY 7-25	Use:	RUNWAY	Area:	829,350 SqFt		
Section:	007	of 9	From:	130+26	To:	156	Last Const.:	9/25/2006	
Surface:	AC	Family:	MN2018 Asphalt Runway- Taxiways	Zone:	N	Category:	2	Rank:	P
Area:	130,500 SqFt	Length:	2,610 Ft	Width:	50 Ft				
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft		
Shoulder:		Street Type:		Grade:	0	Lanes:	0		
Last Insp. Date:	7/1/2018	TotalSamples:	26	Surveyed:	3				
Conditions:	PCI: 79								
Sample Number:	134	Type:	R	Area:	5000.00 SqFt	PCI:	77		
48	L & T CR	M		37.00 Ft					
48	L & T CR	L		235.00 Ft					
57	WEATHERING	L		2000.00 SqFt					
Sample Number:	142	Type:	R	Area:	5000.00 SqFt	PCI:	81		
48	L & T CR	M		16.00 Ft					
57	WEATHERING	L		2000.00 SqFt					
48	L & T CR	L		144.00 Ft					
Sample Number:	150	Type:	R	Area:	5000.00 SqFt	PCI:	79		
48	L & T CR	M		2.00 Ft					
57	WEATHERING	L		2000.00 SqFt					
48	L & T CR	L		198.00 Ft					

Network:	BJI	Name:	BEMIDJI						
Branch:	RY725	Name:	RUNWAY 7-25	Use:	RUNWAY	Area:	829,350 SqFt		
Section:	009	of 9	From:	530+26	To:	556	Last Const.:	9/25/2006	
Surface:	AC	Family:	MN2018 Asphalt Runway- Taxiways	Zone:	N	Category:	2	Rank:	P
Area:	130,500 SqFt	Length:	2,610 Ft	Width:	50 Ft				
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft		
Shoulder:		Street Type:		Grade:	0	Lanes:	0		
Last Insp. Date:	7/1/2018	Total Samples:	26	Surveyed:	3				
Conditions:	PCI: 84								
Sample Number:	532	Type:	R	Area:	5000.00 SqFt	PCI:	86		
57	WEATHERING	L		2000.00	SqFt				
48	L & T CR	L		135.00	Ft				
Sample Number:	540	Type:	R	Area:	5000.00 SqFt	PCI:	84		
57	WEATHERING	L		2000.00	SqFt				
48	L & T CR	L		103.00	Ft				
48	L & T CR	M		2.00	Ft				
Sample Number:	548	Type:	R	Area:	5000.00 SqFt	PCI:	82		
48	L & T CR	L		119.00	Ft				
48	L & T CR	M		17.00	Ft				
57	WEATHERING	L		2000.00	SqFt				

Network:	BJI	Name:	BEMIDJI				
Branch:	TLA	Name:	Taxilane A	Use:	TAXILANE	Area:	62,000 SqFt
Section:	001	of 1	From:	100	To:	112	Last Const.: 6/1/1970
Surface:	AC	Family:	MN2018 Asphalt Taxilanes	Zone:	N	Category:	2
Area:	62,000 SqFt	Length:	250 Ft	Width:	300 Ft	Joint Length:	Ft
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft
Shoulder:		Street Type:		Grade:	0	Lanes:	0
Last Insp. Date:	7/1/2018	Total Samples:	13	Surveyed:	3		
Conditions:	PCI: 21						
Sample Number:	100	Type:	R	Area:	4000.00 SqFt	PCI:	36
57	WEATHERING	H		600.00 SqFt			
48	L & T CR	H		35.00 Ft			
41	ALLIGATOR CR	M		150.00 SqFt			
43	BLOCK CR	L		2000.00 SqFt			
Sample Number:	106	Type:	R	Area:	3900.00 SqFt	PCI:	5
43	BLOCK CR	H		2000.00 SqFt			
41	ALLIGATOR CR	M		800.00 SqFt			
57	WEATHERING	H		1200.00 SqFt			
43	BLOCK CR	M		1250.00 SqFt			
Sample Number:	113	Type:	R	Area:	4700.00 SqFt	PCI:	22
43	BLOCK CR	H		600.00 SqFt			
48	L & T CR	H		16.00 Ft			
41	ALLIGATOR CR	M		24.00 SqFt			
43	BLOCK CR	M		1900.00 SqFt			
57	WEATHERING	H		700.00 SqFt			
45	DEPRESSION	L		29.00 SqFt			
43	BLOCK CR	L		1300.00 SqFt			

Network:	BJI	Name:	BEMIDJI				
Branch:	TLB	Name:	Taxilane B	Use:	TAXILANE	Area:	17,335 SqFt
Section:	001	of 1	From:	100	To:	104	Last Const.: 6/1/2007
Surface:	AC	Family:	MN2018 Asphalt Taxilanes	Zone:	N	Category:	2
Area:	17,335 SqFt	Length:	471 Ft	Width:	35 Ft	Joint Length:	Ft
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft
Shoulder:		Street Type:		Grade:	0	Lanes:	0
Last Insp. Date:	7/1/2018	TotalSamples:	5	Surveyed:	2		
Conditions:	PCI: 89						
Sample Number:	101	Type:	R	Area:	3500.00 SqFt	PCI:	94
48	L & T CR		L		50.00 Ft		
Sample Number:	103	Type:	R	Area:	3500.00 SqFt	PCI:	85
48	L & T CR		L		82.00 Ft		
48	L & T CR		M		29.00 Ft		

Network:	BJI	Name:	BEMIDJI				
Branch:	TXRose	Name:	Compass Rose Taxiway	Use:	TAXIWAY	Area:	21,100 SqFt
Section:	001	of 1	From:	100	To:	103	Last Const.: 9/1/2008
Surface:	AC	Family:	MN2018 Asphalt Runway- Taxiways	Zone:	N	Category:	2 Rank: T
Area:	21,100 SqFt	Length:	325 Ft	Width:	50 Ft		
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft
Shoulder:		Street Type:		Grade:	0	Lanes:	0
Last Insp. Date:	7/1/2018	TotalSamples:	3	Surveyed:	1		
Conditions:	PCI: 95						
Sample Number:	100	Type:	R	Area:	5000.00 SqFt	PCI:	95
48	L & T CR		L	50.00	Ft		

Appendix D

Distress Identification

This appendix lists and describes distress types most commonly identified during the PCI inspections of Minnesota airports. Note that the pictures provided in this appendix are for illustration purposes and do not necessarily reflect the conditions or pavements at this airport. Descriptions and measurement inspection criteria are provided herein.

Flexible (Asphalt) Pavement Distress

Example of Longitudinal and Transverse Cracking (L&T cracking)



Longitudinal and transverse cracks are caused by pavement aging, by construction, and by subsurface movement. Aging occurs as pavement loses some of its components to the atmosphere and becomes more brittle. Consistent application of pavement sealcoats can help to prevent the occurrence of age related cracks. Cracks will also develop along poorly constructed paving lane joints. Ensuring that joints are made when both sides are still hot, and near the same temperature, is one of the best ways to mitigate this potential problem. Seasonal movement caused by changes in moisture content or temperature differences can also cause pavement cracks. Asphalt pavement placed over a PCC pavement or cement stabilized base course may evidence reflective cracking from the underlying material. Longitudinal and transverse cracks are not caused by wheel loads, although traffic may worsen their condition.

Low severity longitudinal and transverse cracks are less than $\frac{1}{4}$ inch wide, or if sealed with suitable filler material in satisfactory condition can be any width, less than 3 inches, if they are not spalled. Maintenance usually is not indicated for low-severity cracking. Moderately spalled cracks and cracks wider than $\frac{1}{4}$ inch which are not satisfactorily sealed are at medium severity. Medium-severity cracks should be sealed with a high-quality crack filling material. Severely spalled cracks and cracks wider than 3 inches are at high severity. High-severity L&T cracks normally require patching.

Example of Block Cracking



Block cracking is longitudinal and transverse cracking that has established a pattern of blocks ranging in size from 1ft x 1ft to 10ft x 10ft. This distress typically happens in older asphalt pavements and is an indication that the bituminous binder has lost most of its flexibility. The severity determination is basically determined by the crack width criteria defined for longitudinal and transverse cracking. Crack sealing typically is used to repair block cracking; however, the amount of required sealant can be extensive due to the high density of cracks.

Example of Alligator Cracking



Alligator (or fatigue) cracks are a series of interconnected load-related cracks caused by fatigue of the asphalt surface. Alligator cracking is a significant structural distress and develops only in places subject to traffic loads. These cracks typically initiate at the bottom of the asphalt layer (where tensile strains

are highest) and propagate upward - so once a fatigue crack is visible, significant damage has already occurred.

At low severity, alligator cracks are evidenced by a series of parallel hairline cracks (usually in a wheel path). Further traffic and deterioration leads to the interconnection of these cracks. Medium severity alligator cracking is a well-defined pattern of interconnected cracks, some spalling may be present. High severity alligator cracks have lost aggregate interlock between adjacent pieces, the cracks may be severely spalled with FOD potential, and most likely the pieces will move freely under traffic. Alligator cracking is a structural failure and cannot be repaired with sealant, the proper repair is full-depth patching.

Example of Raveling/Weathering



Raveling and weathering are the wearing away of the pavement surface. Raveling is the condition where the mid- to large size aggregates are becoming dislodged; weathering is when the fine aggregate wears away exposing the edges of the larger aggregate. These distresses are usually evident over large areas and may occur together (pictured above) or separately. Raveling and weathering may indicate that the asphalt binder has hardened significantly.

Raveling – At low severity, the number of missing coarse aggregates (> 3/8 inch) is between 5-20 missing/yd², medium severity (pictured below where the missing coarse aggregates have been dotted with yellow paint) is 21-40 missing/yd², and high severity is > 40 missing/yd².



Weathering – At low severity, the coarse aggregate is slightly exposed due to the wearing away of the fine aggregate. At medium severity, the coarse aggregate is exposed up to ¼ the width of the longest side. At high severity, the coarse is exposed greater than ¼ the width of the longest side.

Low severity



Medium severity



High severity



Example of Patching



Patched areas are defined when a portion of the original pavement is replaced with a material intended as a semi-permanent repair. A patch is documented as a defect because it is considered a break in the integrity of the pavement structure. Patches are constructed for a variety of reasons including utility repairs, correcting grade issues, and addressing a defect in the original pavement. The severity level of patches is determined by the amount of distress (i.e. cracking, depression, weathering/raveling, etc.) occurring within the limits of the patched area.

Example of Rutting



Ruts are localized, load related, areas of pavement having elevations lower than the surrounding sections. Rutting is due to base and subgrade consolidation, caused by excessive wheel loads or poor compaction. Ruts indicate structural failure, and can cause hydroplaning. At low severity, ruts have an

average depth of ¼ to ½ inches. At medium severity, ruts have an average depth of ½ to 1 inch. High severity, ruts have an average depth greater than 1 inch. Full-depth patching is the appropriate repair for ruts.

Rigid (Concrete) Pavement Distress

Example of Longitudinal, Transverse, and Diagonal Cracking



LTD cracking is most often a result of externally applied loads and/or constrained temperature deformations. External loads cause LTD cracking through flexure. Temperature changes on restrained slabs will result in stresses due to friction or curling. When any of these stresses exceed the strength of the slab, cracking will occur. LTD cracking is recorded at low, medium, or high severity, depending on the width of crack opening and degree of deterioration. At low severity, the crack is less than 1/8th inch wide with little spalling and no corrective action is indicated. At medium severity, LTD cracks can be up to 1 inch wide with moderate spalling, and should be repaired and sealed using procedures similar to joint sealing. At high severity, cracks exceed 1 inch in width and may be severely spalled. High-severity LTD cracking is evidence of serious load failure of the slab, and correction may require patching or slab replacement. If the distress occurs in several adjacent slabs at medium or high severity, major rehabilitation of that pavement area is indicated.

When a slab is divided by LTD cracks into four or more pieces, the slab is said to be "divided" or "shattered." Shattered slab is a separate distress category and is indicative of significant structural failure as the slab loses its ability to distribute loads to subgrade and further slab deterioration can be expected. Shattered slabs are rated in three severities, with slab replacement recommended for medium and high severities.

Example of Shrinkage Cracking



Shrinkage cracks are small, nonworking (no spalling along edge) cracks that are visible at the surface but do not penetrate through the full depth of concrete. Shrinkage cracks most commonly occur shortly after construction due to concrete shrinkage during the curing process. Shrinkage cracks are usually so small that they are not visible until staining or material loss at crack edges begins to take place. Shrinkage cracks do not represent a structural weakness, and no corrective action is prescribed.

Example of Joint and Corner Spalling



Spalls at slab joints and corners are caused by excessive internal stress in the pavement. Spalls occur when these stresses exceed the shear strength of the concrete. Spalling usually results from thermal expansion during warm or hot weather. As slabs expand, they push against one another at joints. If the joints are filled with incompressibles, such as sand, or if adjacent slabs offset slightly, stresses can become severe, causing spalls. Spalling can be reduced significantly by conscientious maintenance of joint sealant.

Spall repair requires patching. The extent and severity of spalling on a pavement surface suggests appropriate action. For example, at low severity, spalled concrete remains securely in place in the slab. A low-severity spall should be monitored closely for further deterioration and should be patched when

spalled particles become loose in place, or at the next scheduled patching activity in the section. Medium- and high-severity spalls should be repaired immediately to prevent the incidence of FOD. If the pavement can be restored to serviceable condition, spalls should be carefully patched for long-term service. If the pavement is beyond repair, temporary patching should be considered to control FOD.

Example of Durability Cracking



Durability cracking (D-cracking) is caused by environmental factors, the most common of which is freezing/thawing. It usually appears as a pattern of hairline cracks running parallel to a joint or crack, or in a corner, where water tends to collect. This type of cracking eventually leads to disintegration of the pavement, creating FOD potential. At low severity, D-cracking is evident, but no disintegration has occurred. As the distress advances to medium severity, the distress pattern is evident over a significant area of the slab, and some disintegration and FOD potential exists. High severity durability cracking is evidenced by extensive cracking with loose and missing pieces and significant FOD potential.

Example of Joint Seal Damage



Joint seal damage is recorded at three severities: low, medium, and high. When joint sealant is in perfect condition (no damage), it is not a distress. At low severity, at least 10 percent of the sealant is debonded but still in contact with the joint edges (i.e., joint sealant is in serviceable condition but should

be monitored for evidence of more serious failure). Medium-severity joint seal damage is recorded when at least 10 percent of the sealant has visible gaps smaller than 1/8th inch and is an indicator that replacement should be programmed as soon as is practicable. In the meantime, aggressive inspection and sustaining maintenance is recommended to minimize subsurface damage from moisture penetration. At high severity, visible gaps exceed 1/8th inch and the amount and degree of joint seal damage is such that repair is no longer feasible. The only appropriate corrective action is sealant replacement.

On serviceable pavement, deteriorated joint sealant should be repaired or replaced to preserve pavement and subgrade integrity and prolong service life. The issue is not so clear-cut with unserviceable pavement. Pavement that can be restored to serviceable condition by maintenance activities such as patching and joint seal repair, or by slab replacement, should be so maintained as long as the process is cost-effective. However, when age and condition preclude economical return to serviceable condition by such means, joint seal repair would no longer be cost-effective and should be suspended except for an interim maintenance program to control FOD potential.

Joint sealant can stop the evidence of pumping (water forced to surface through joints and cracks) but will not correct the cause (voids under pavement).

This page intentionally left blank.

Appendix E

Maintenance and Major Rehabilitation Policies

Table E1. Localized maintenance policy for asphalt surfaces.

Distress type	Distress severity	Maintenance treatment
Alligator cracking	Low	Crack Sealing - AC
	Medium	Patching - AC Deep
	High	Patching - AC Deep
Bleeding	N/A	Monitor
Block cracking	Low	Monitor
	Medium	Crack Sealing - AC
	High	Crack Sealing - AC
Corrugation	Low	Monitor
	Medium	Patching - AC Deep
	High	Patching - AC Deep
Depression	Low	Monitor
	Medium	Patching - AC Shallow
	High	Patching - AC Deep
Jet blast	N/A	Patching - AC Shallow
Joint reflection cracking	Low	Monitor
	Medium	Crack Sealing - AC
	High	Crack Sealing - AC
Longitudinal & transverse cracking (L&T cracking)	Low	Monitor
	Medium	Crack Sealing - AC
	High	Crack Sealing - AC
Oil spillage	N/A	Patching - AC Shallow
Patching	Low	Monitor
	Medium	Patching - AC Shallow
	High	Patching - AC Deep
Polished aggregate	N/A	Monitor
Raveling	Low	Monitor
	Medium	Surface Treatment
	High	Patching - AC Shallow
Rutting	Low	Monitor
	Medium	Patching - AC Deep
	High	Patching - AC Deep
Shoving	Low	Monitor
	Medium	Patching - AC Shallow
	High	Patching - AC Deep
Slippage cracking	N/A	Patching - AC Shallow
Swelling	Low	Monitor
	Medium	Patching - AC Deep
	High	Patching - AC Deep
Weathering	Low	Monitor
	Medium	Surface Treatment
	High	Patching - AC Shallow

Table E2. Localized maintenance policy for PCC surfaces.

Distress type	Distress severity	Maintenance treatment
Blow up	Low	Patching - PCC Partial Depth
	Medium	Slab Replacement - PCC
	High	Slab Replacement - PCC
Corner break	Low	Monitor
	Medium	Patching - PCC Full Depth
	High	Patching - PCC Full Depth
Linear cracking	Low	Monitor
	Medium	Crack Sealing - PCC
	High	Patching - PCC Full Depth
Durability cracking	Low	Monitor
	Medium	Patching - PCC Full Depth
	High	Slab Replacement - PCC
Joint seal damage	Low	Monitor
	Medium	Joint Seal (Localized)
	High	Joint Seal (Localized)
Small patch	Low	Monitor
	Medium	Patching - PCC Partial Depth
	High	Patching - PCC Partial Depth
Large patch	Low	Monitor
	Medium	Patching - PCC Full Depth
	High	Patching - PCC Full Depth
Popouts	N/A	Monitor
Pumping	N/A	Monitor
Scaling	Low	Monitor
	Medium	Patching - PCC Partial Depth
	High	Slab Replacement - PCC
Faulting	Low	Monitor
	Medium	Grinding (Localized)
	High	Grinding (Localized)
Shattered slab	Low	Monitor
	Medium	Crack Sealing - PCC
	High	Slab Replacement - PCC
Shrinkage cracking	N/A	Monitor
Joint spall	Low	Monitor
	Medium	Patching - PCC Partial Depth
	High	Patching - PCC Partial Depth
Corner spall	Low	Monitor
	Medium	Patching - PCC Partial Depth
	High	Patching - PCC Partial Depth
ASR	Low	Monitor
	Medium	Patching - PCC Full Depth
	High	Slab Replacement - PCC

Table E3. Unit costs for localized maintenance treatments.

Treatment name	Unit cost
Crack Sealing - AC	\$1.26 ft
Crack Sealing - PCC	\$1.92 ft
Grinding (Localized)	\$4.98 ft
Joint Seal (Localized)	\$1.92 ft
Patching - AC Deep	\$11.82 sf
Patching - AC Leveling	\$4.14 sf
Patching - AC Shallow	\$7.95 sf
Patching - PCC Full Depth	\$74.32 sf
Patching - PCC Partial Depth	\$10.68 sf
Slab Replacement - PCC	\$40.00 sf
Surface Treatment	\$0.52 sf
Undersealing - PCC	\$3.17 ft

Table E4. Major rehabilitation unit costs based on PCI ranges.

PCI range	Cost
0-30	\$8.59 sf
30-40	\$8.59-\$7.13 sf
40-50	\$7.13-\$5.94 sf
50-60	\$5.94-\$4.19 sf
60-70	\$4.19-\$2.66 sf
70-80	\$2.66-\$1.30 sf
> 80	\$1.30 sf

This page intentionally left blank.

Appendix F

Localized Maintenance Recommendations

Table F.1. Recommended maintenance by section report (BJI)

Branch	Section	Treatment	Quantity	Unit	Cost
ADNR	001	Crack Sealing - AC	181	Ft	\$229
ADNR	001	Surface Treatment	2,315	SqFt	\$1,204
Preventive		PCI Before: 63 After: 69	-	Total	\$1,432
APA	001	Crack Sealing - AC	182	Ft	\$230
APA	001	Patching - AC Shallow	578	SqFt	\$4,598
Preventive		PCI Before: 86 After: 89	-	Total	\$4,828
APB	001	Patching - PCC Partial Depth	58	SqFt	\$622
Preventive		PCI Before: 94 After: 100	-	Total	\$622
APB	002	Crack Sealing - PCC	37	Ft	\$71
APB	002	Patching - PCC Partial Depth	83	SqFt	\$888
Preventive		PCI Before: 70 After: 82	-	Total	\$959
APB	003	Crack Sealing - PCC	1,964	Ft	\$3,771
APB	003	Patching - PCC Full Depth	111	SqFt	\$8,220
APB	003	Patching - PCC Partial Depth	32	SqFt	\$335
Restorative		PCI Before: 49 After: 71	-	Total	\$12,326
APB	004	Joint Seal (Localized)	2,238	Ft	\$4,296
APB	004	Patching - PCC Partial Depth	76	SqFt	\$819
Preventive		PCI Before: 81 After: 93	-	Total	\$5,115
CTC	001	Crack Sealing - AC	23	Ft	\$29
Preventive		PCI Before: 91 After: 94	-	Total	\$29
CTD	001	Crack Sealing - AC	31	Ft	\$39
Preventive		PCI Before: 82 After: 86	-	Total	\$39
PTA	002	Crack Sealing - AC	37	Ft	\$47
Preventive		PCI Before: 88 After: 89	-	Total	\$47
PTAX	001	Crack Sealing - AC	20	Ft	\$25
Preventive		PCI Before: 82 After: 86	-	Total	\$25
PTB	001	Crack Sealing - AC	1,079	Ft	\$1,359
Preventive		PCI Before: 86 After: 88	-	Total	\$1,359
RY1331	001	Crack Sealing - AC	148	Ft	\$186
Preventive		PCI Before: 86 After: 90	-	Total	\$186
RY1331	002	Crack Sealing - AC	24	Ft	\$30
Preventive		PCI Before: 77 After: 80	-	Total	\$30
RY1331	003	Crack Sealing - AC	120	Ft	\$151
Preventive		PCI Before: 78 After: 82	-	Total	\$151
RY1331	004	Crack Sealing - AC	17	Ft	\$21
Preventive		PCI Before: 86 After: 87	-	Total	\$21
RY1331	005	Crack Sealing - AC	216	Ft	\$271
Preventive		PCI Before: 79 After: 80	-	Total	\$271
RY1331	006	Crack Sealing - AC	356	Ft	\$449
Preventive		PCI Before: 81 After: 84	-	Total	\$449

Branch	Section	Treatment	Quantity	Unit	Cost
R725	001	Crack Sealing - AC	143	Ft	\$180
Preventive		PCI Before: 81 After: 83	-	Total	\$180
R725	002	Crack Sealing - AC	95	Ft	\$120
Preventive		PCI Before: 79 After: 82	-	Total	\$120
R725	003	Crack Sealing - AC	55	Ft	\$70
Preventive		PCI Before: 82 After: 83	-	Total	\$70
R725	004	Crack Sealing - AC	249	Ft	\$314
Preventive		PCI Before: 81 After: 88	-	Total	\$314
R725	005	Crack Sealing - AC	75	Ft	\$95
Preventive		PCI Before: 77 After: 79	-	Total	\$95
R725	006	Crack Sealing - AC	134	Ft	\$169
Preventive		PCI Before: 83 After: 88	-	Total	\$169
R725	007	Crack Sealing - AC	478	Ft	\$603
Preventive		PCI Before: 79 After: 83	-	Total	\$603
R725	008	Crack Sealing - AC	113	Ft	\$143
Preventive		PCI Before: 78 After: 80	-	Total	\$143
R725	009	Crack Sealing - AC	165	Ft	\$208
Preventive		PCI Before: 84 After: 87	-	Total	\$208
TLA	001	Crack Sealing - AC	8,875	Ft	\$11,182
TLA	001	Patching - AC Deep	5,075	SqFt	\$59,991
TLA	001	Patching - AC Shallow	12,302	SqFt	\$97,798
Restorative		PCI Before: 21 After: 49	-	Total	\$168,971
TLB	001	Crack Sealing - AC	72	Ft	\$90
Preventive		PCI Before: 89 After: 92	-	Total	\$90

Table F.2. Recommended maintenance by treatment (04Y)

Branch	Section	Distress Type	Severity	Treatment	Estimated Quantity	Unit	Cost
ADNR	001	L & T CR	M	Crack Sealing - AC	181	Ft	\$229
APA	001	L & T CR	M	Crack Sealing - AC	182	Ft	\$230
CTC	001	L & T CR	M	Crack Sealing - AC	23	Ft	\$29
CTD	001	L & T CR	M	Crack Sealing - AC	31	Ft	\$39
PTA	002	L & T CR	M	Crack Sealing - AC	37	Ft	\$47
PTAX	001	L & T CR	M	Crack Sealing - AC	20	Ft	\$25
PTB	001	L & T CR	M	Crack Sealing - AC	1,079	Ft	\$1,359
RY1331	001	L & T CR	M	Crack Sealing - AC	148	Ft	\$186
RY1331	002	L & T CR	M	Crack Sealing - AC	24	Ft	\$30
RY1331	003	L & T CR	M	Crack Sealing - AC	120	Ft	\$151
RY1331	004	L & T CR	M	Crack Sealing - AC	17	Ft	\$21
RY1331	005	L & T CR	M	Crack Sealing - AC	216	Ft	\$271
RY1331	006	L & T CR	M	Crack Sealing - AC	356	Ft	\$449
RY725	001	L & T CR	M	Crack Sealing - AC	143	Ft	\$180
RY725	002	L & T CR	M	Crack Sealing - AC	95	Ft	\$120
RY725	003	L & T CR	M	Crack Sealing - AC	55	Ft	\$70
RY725	004	L & T CR	M	Crack Sealing - AC	249	Ft	\$314
RY725	005	L & T CR	M	Crack Sealing - AC	75	Ft	\$95
RY725	006	L & T CR	M	Crack Sealing - AC	134	Ft	\$169
RY725	007	L & T CR	M	Crack Sealing - AC	478	Ft	\$603
RY725	008	L & T CR	M	Crack Sealing - AC	113	Ft	\$143
RY725	009	L & T CR	M	Crack Sealing - AC	165	Ft	\$208
TLA	001	BLOCK CR	H	Crack Sealing - AC	3,900	Ft	\$4,913
TLA	001	BLOCK CR	M	Crack Sealing - AC	4,724	Ft	\$5,953
TLA	001	L & T CR	H	Crack Sealing - AC	251	Ft	\$316
TLB	001	L & T CR	M	Crack Sealing - AC	72	Ft	\$90
				Total:	12,891	Ft	\$16,242
APB	002	LINEAR CR	M	Crack Sealing - PCC	37	Ft	\$71
APB	003	LINEAR CR	M	Crack Sealing - PCC	1,711	Ft	\$3,285
APB	003	SHAT. SLAB	M	Crack Sealing - PCC	254	Ft	\$487
				Total:	2,001	SqFt	\$3,842
APB	004	JT SEAL DMG	M	Joint Seal (Localized)	2,238	Ft	\$4,296
				Total:	2,238	SqFt	\$4,296
TLA	001	ALLIGATOR CR	M	Patching - AC Deep	5,075	SqFt	\$59,991
				Total:	5,075	SqFt	\$59,991
APA	001	OIL SPILLAGE	N/A	Patching - AC Shallow	578	SqFt	\$4,598
TLA	001	WEATHERING	H	Patching - AC Shallow	12,302	SqFt	\$97,798
				Total:	12,880	SqFt	\$102,396

Branch	Section	Distress Type	Severity	Treatment	Estimated Quantity	Unit	Cost
APB	003	CORNER BREAK	H	Patching - PCC Full Depth	111	SqFt	\$8,220
				Total:	111	SqFt	\$8,220
APB	001	CORNER SPALL	M	Patching - PCC Partial Depth	10	SqFt	\$107
APB	001	JOINT SPALL	M	Patching - PCC Partial Depth	48	SqFt	\$515
APB	002	CORNER SPALL	H	Patching - PCC Partial Depth	5	SqFt	\$57
APB	002	CORNER SPALL	M	Patching - PCC Partial Depth	5	SqFt	\$57
APB	002	SCALING	M	Patching - PCC Partial Depth	70	SqFt	\$745
APB	002	SMALL PATCH	M	Patching - PCC Partial Depth	2	SqFt	\$29
APB	003	CORNER SPALL	H	Patching - PCC Partial Depth	10	SqFt	\$98
APB	003	JOINT SPALL	M	Patching - PCC Partial Depth	23	SqFt	\$236
APB	004	JOINT SPALL	H	Patching - PCC Partial Depth	60	SqFt	\$647
APB	004	JOINT SPALL	M	Patching - PCC Partial Depth	16	SqFt	\$172
				Total:	250	SqFt	\$2,664
ADNR	001	WEATHERING	M	Surface Treatment	2,315	SqFt	\$1,204
				Total:	2,315	SqFt	\$1,204

Appendix G

Maintenance Repair Guidelines

General Comments

Ongoing inspections are the cornerstone of a maintenance management program. Crack sealing prevents surface water from entering the pavement structure and helps prevent the introduction of incompressible material into the paving joints and cracks, reducing the chances for spalls and further pavement deterioration.

Preservation of a pavement system will require a combination of preventive, sustaining, and restorative maintenance repairs. Preventive maintenance is primarily an inspection program, sustaining maintenance is an ongoing maintenance function, whose purpose is to seal newly formed cracks in areas where the sealant is in otherwise satisfactory condition. Restorative repairs are major work items, often performed under contract that typically involves complete removal and replacement of existing sealant.

Maintenance Activities

Flexible (Asphalt) Pavement

Longitudinal and transverse (L&T) cracks at medium severity ($>1/4$ " wide) should be filled with a good quality crack filler material. High-severity cracks must normally be patched. Cracks rated at low severity may be narrow-unsealed cracks or sealed cracks up to 3 inches wide. The PCI procedure does not distinguish between narrow unfilled cracks and wider filled cracks. When 25 percent or more of total crack quantity is at medium or high severity, a restorative program becomes cost-effective. When medium- or high-severity cracking constitutes less than 25 percent of the total, sustaining maintenance is usually more cost-effective.

Medium- and high-severity existing patches should be replaced with new patches. Small areas (usually less than 100 square feet per patch) of alligator cracking and rutting at medium and high severity may also be repaired by patching. Larger patches should be considered if equipment can be made available to accomplish the work. Patching to repair up to 10 percent of the surface of a pavement section that is otherwise serviceable can result in significant cost savings as compared to rehabilitation of the entire section.

PCC (Concrete) Pavement

Joint seal damage at medium and high severity should be repaired. If medium- and high-severity damage is limited to less than about 25 percent of total joint length, sustaining maintenance is recommended. If medium and high-severity damage exceeds about 25 percent of the total joint length, joint sealant should be removed and replaced under a restorative repair project.

Longitudinal/transverse/diagonal (LTD) cracks at low and medium severity should be considered for sealing as part of the joint sealing project. High-severity LTD cracks require sealing, patching, or slab replacement, depending on the extent of deterioration.

Small patches are most often placed to repair medium- and high-severity spalls or to replace deteriorated older patches. Restorative small patches are typically partial depth repairs, usually to load transfer steel. Large patches and corner breaks at medium and high severity should be repaired by full-depth large patches.

High-severity LTD cracks and shattered slabs are candidates for patching and slab replacement. Low-severity shattered slabs can be left in place pending further deterioration.

Pavement Failure

Before maintenance and repairs are attempted, it helps to have an understanding of the way pavement performs and deteriorates.

Environmental/Age-Related Deterioration

Seasonal temperature changes cause expansion and contraction of the pavement materials, causing the pavement to move up to 1 foot per 1,000 feet. Much of this movement can be witnessed as the opening and closing of existing transverse cracks.

The pavement thickness and type of subgrade plays a large role in the formation and spacing interval of transverse cracks. If the subgrade material is smooth or rounded, the pavement surface will move relatively freely, the transverse cracks will usually be spaced far apart (>60 feet). If the subgrade material is rough or angular the pavement surface will not move freely and transverse cracks will be spaced more closely (<40 feet). The distance between transverse cracks will also depend on the pavement thickness, as a thicker pavement can resist cracking for longer lengths, but around 50 feet is typical for general aviation airport pavements.

Age related distress deals with the pavement oxidation or loss of volatile components to the atmosphere. An oxidized pavement becomes more brittle with time. Surface treatments and seal coats are designed, in part, to provide a protective barrier and prevent this type of oxidation.

Materials Related Deterioration

Subsurface water can have the greatest impact on pavement deterioration. A wet subgrade greatly reduces the ability of a pavement to support wheel loads, and the results often show up as rutting and cracking. The fine materials in a wet base can be pumped up through the cracks and eventually result in a loss of subgrade support. This loss of support can be evidenced as corner breaks and faulting. Moisture inside a pavement system expands when it freezes; creating stresses that push and tear at the pavement. The following thaw cycles will leave voids in the pavement structure that enable further rutting and breaking. Repeated freeze/thaw cycles will eventually cause pavement to disintegrate. One of the best ways to assure pavement longevity is to provide drainage and keep the subgrade dry.

Aggregate is the biggest component of any pavement structure, and it is the contact between the aggregate particles that actually transfers the load and provides the strength. Aggregate durability and shape are major factors affecting pavement performance. Durability is the ability of the aggregate to perform satisfactorily over time and resist the detrimental effect of nature. Sharp, well-angled aggregate that interlock, compact densely, and resists movement are the most desirable.

Air Voids

Well-distributed interconnected air voids allow escape paths for freezing water and generally reduce susceptibility to freeze/thaw damage. In PCC pavements, closely spaced interconnected air voids provide the greatest degree of protection.

Asphalt pavements, on the other hand, only tolerate air voids as necessary. Air voids allow for expansion of the asphalt binder, but also allow water penetration into the pavement. Interconnected air voids are undesirable here because the voids allow air to penetrate the asphalt layers and oxidize the binder. As air voids increase, durability and flexibility decrease, but stability and skid resistance increase. Asphalt pavements should be designed and compacted so that air voids are not interconnected. The air voids should allow only for the expansion of the asphalt and aggregate without, bleeding, and air voids should be kept low enough to prevent water and air from penetrating the asphalt layers.

Binders

Regardless of whether the pavement is asphalt or concrete, the binder material is mixed with the aggregate to coat all particles with a thin film. An asphalt coating allows the pavement to be flexible and still resist large movements. Durability of the asphalt pavement is increased by a thicker film because it is more resistant to age hardening; however, too thick of a film and the asphalt acts like a lubricant, promoting ruts, shoving, and bleeding. Specifications control aggregate and binder mix quantities, but each mix should be customized for materials available locally.

With a concrete pavement, the aggregate supports the load, but the cement binder interlocks with the aggregate to inhibit all movement. Hydration is the term for the chemical reaction of portland cement with water, and in the hydration process, dry cement particles react with water, to form gels, and then crystals, that grow and bond with the aggregate to form a rigid interlocking structure. Hydration can continue for years, but much of the ultimate strength will be reached within 28 days. Hydration is a sensitive chemical process, and typically, any admixtures used to accelerate the hydration process will reduce durability, and their use should be considered carefully or avoided.

Stress Distribution/Load Related Deterioration

PCC (rigid) and asphalt (flexible) pavements differ in the way loads are distributed. A concrete slab resists bending and transfers loads evenly, an asphalt pavement is designed to bend, and gradually spreads loads over wider areas. Rutting is a subgrade failure caused by a compressive yielding of the subgrade.

Load-related cracks can start at the top or bottom of a pavement section. In asphalt sections, load-related (fatigue) cracks start at the bottom. If a load-related crack reaches the surface, it usually indicates significant structural deficiency. In PCC pavement, corner breaks are caused by top tension, and the crack propagates downward. Mid-slab LTD cracks are examples of bottom tension.

Spalls can be caused by either wheel loads or environmental factors, anytime there is movement between adjacent slabs. If a small rock is allowed into a joint, a differential movement between adjacent slabs can cause a spall. Spalling can be minimized by keeping joint and crack sealant intact.

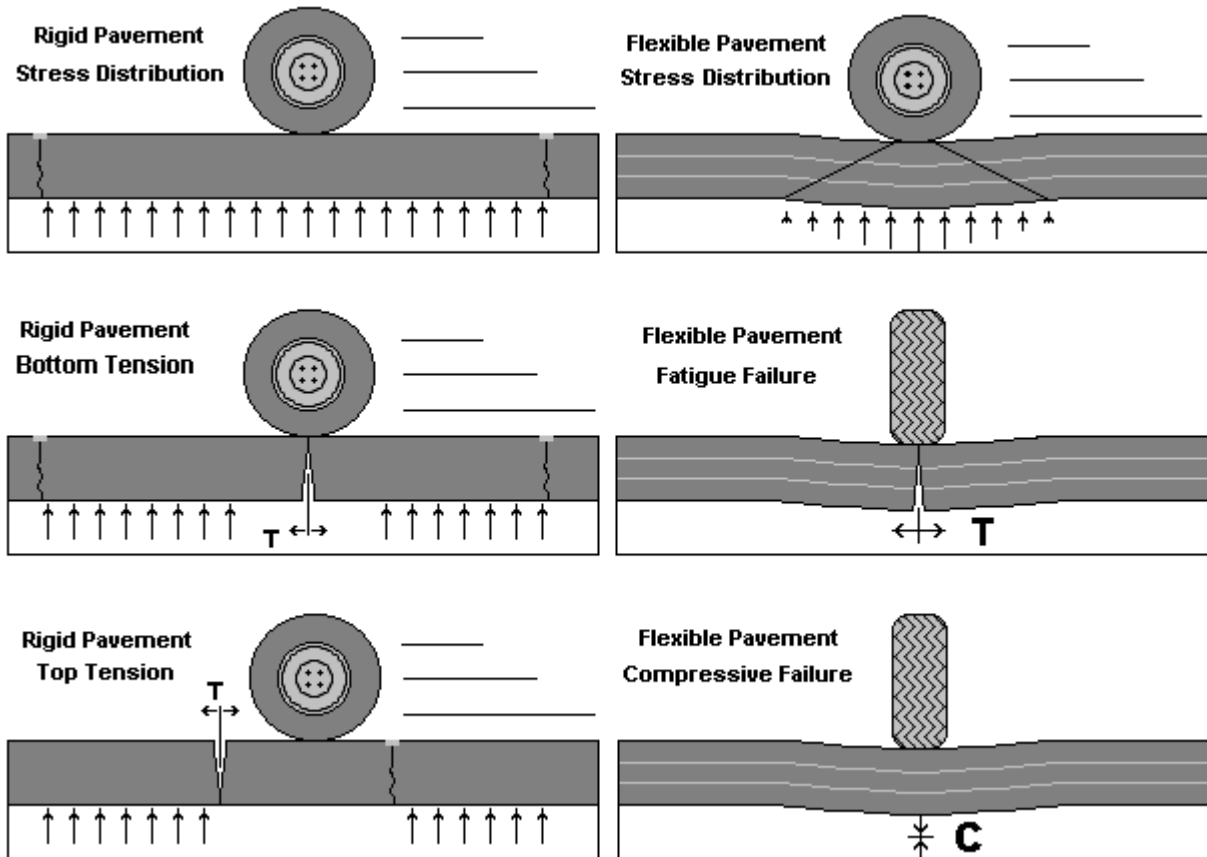


Figure 1. Pavement failure.

Points to Remember

Pavement wears out.

The longer a pavement remains in service, the greater the effort needed to keep it in service. A good maintenance and repair program will increase service life significantly, but cannot be expected to extend service life indefinitely.

Pavement moves.

Pavement moves in response to temperature changes. Transverse cracks can vary from nearly closed in the summer to open an inch or more in winter. This movement cannot be prevented. It must be understood and provided for during design and construction. The changing crack widths will dictate the reservoir size required for sealant. Measure cracks at their widest and narrowest states, then prepare adequate ($\frac{1}{2}$ - $1\frac{1}{2}$ inch) sealant reservoirs for crack sealing projects.

Longitudinal joints and cracks are important.

The most important reason for sealing cracks is to deny surface water access to the pavement and subgrade. Most water drains from centerline to shoulders. Longitudinal cracks, which run parallel to the centerline provide the greatest potential to divert water into the pavement structure, and must be sealed.

Sealing is not always the best answer.

The FAA maximum allowable open trench width on aircraft movement areas is three-inches; therefore, any crack wider than three-inches should be patched. A severe spall or a crack that has settled below the pavement elevation indicates a failure. If the pavement has disintegrated to the point that aggregate interlock is lost, sealant alone will not be sufficient, and patching should be considered.

Maintenance and repairs must be done correctly.

To achieve optimum results from repairs, proper preparation, use of quality materials, and proper application are essential. Any shortcuts will reduce the quality and effectiveness of the repairs. A rule of thumb is that proper maintenance will last twice as long as an unprepared area. Good maintenance takes time and deserves high-quality materials.

Schedule maintenance and repair activities carefully.

Any pavement defect can be corrected. Concentrate on repairs that are cost-effective, operationally important, and that extend service life. Some surface blemishes can be ignored safely, and many structural problems are beyond economical correction. When future rehabilitation is imminent, maintenance activities should be limited to only those that ensure continued safety and minimize foreign object damage (FOD) potential.

Equipment

Many excellent pavement repair and sealing products are available. Specialized tools and equipment help ensure quality repairs. This section reviews equipment compatible with airport needs.

Air Compressor

Used to remove sand and debris from prepared cracks and joints, the compressor should have a sustained capacity of 120 cubic feet per minute with a nozzle velocity of 100 psi. Trailer-mounted compressors typically have capacities in this range.

Concrete Saw

A saw capable of making a minimum 3-inch deep cut is required. The saw should be capable of making cuts in asphalt or concrete. Gasoline-powered 5-25 hp wheel mounted saws typically are preferred for this type of work, but electric and pneumatic tools are also available.

Heating Kettle

Applying sealant is the most time-consuming operation, and a sealing machine with heating and pressure application capabilities is a critical item in a sealing program. The capacity of the sealing equipment dictates the rate at which a crew progresses. For large sealing projects, a minimum 100 gallons/per hour sustained capacity is recommended. The unit should be a double boiler type, with mechanical agitators or continuous recirculation.

Router

A concrete saw can be used to prepare joints, but for random cracking, a mechanical router with a vertical impact mechanism is preferred. When cracks are being routed, this activity will dictate speed of the crew. Crack routers in the 25hp range are commonly used and are available from a variety of manufacturers.

Sand Cleaner

A sand blaster helps to clean loose particles and dust from prepared cracks. The unit must have sufficient force to expose fresh, vital pavement to bond with sealant and patching materials.

Vibratory Roller or Plate Compactor

Required to properly compact plant mixed and packaged patching materials. Small rollers are best for pothole type applications, plate compactors are best for large areas.

Other Equipment

Other general use equipment that can be helpful in a maintenance program includes bucket loaders, dump trucks, water tanks, and a power sweeper unit.

Materials

Pavement repair materials are constantly being introduced and improved. This section provides information on products compatible with airport needs.

Joint and Crack Sealer

Hot poured, pressure injected, polymeric rubberized asphalt sealant meeting ASTM D3405 specifications is suitable for most joint and crack sealing requirements. This product is relatively inexpensive, durable, and suitable for both PCC and asphalt pavements. Other, more expensive, hot applied sealants that promise longer life are being developed for specialty applications, and twin component cold applied sealants, similar to URASEAL 200, have also been used with success. Contact your local distributor.

Flexible Pavement Patch

Long-term patches should be made with a high-quality plant mixed hot asphalt having a ¾-inch maximum aggregate size and meeting FAA P401, or highest quality highway specifications. High-performance plant mixed cold patching products that can be stockpiled on-site have been developed. Low-quality packaged materials available from local hardware type stores should be avoided and only be used for temporary patches that maintain safety and service.

PCC Pavement Patch

Permanent patches in PCC pavement should be made with a minimum 6-bag mix of hi-early air-entrained cement with 1-inch maximum size aggregate. Concrete should have zero slump and a coarse texture. As with asphalt patches, low-quality packaged materials should only be used as temporary patches to maintain safety and service until a more permanent repair can be made.

Techniques

Crack Sealing

- Cracks over ¼ inches wide should be sealed. Cracks wider than 3 inches should be patched.
- Sealant depth above the backer rope should be equal to the width of the reservoir, or as recommended by the manufacturer.
- Routed cracks should be sand blasted, to prepare the vertical edges for bonding with the sealant. Clean cracks with compressed air prior to sealing.
- Backing material should always be placed into the cracks. Commercial products are available, and several sizes of rope should always be available to accommodate various crack sizes.
- Apply sealant after placing the backer rope. Follow the manufacturer's instructions. Sealant should be applied to within ¼ inch of the pavement surface.
- The final activity is to clean the surrounding pavement areas. A vacuum sweeper works well for this. Allow the sealant time to set, before using a broom.

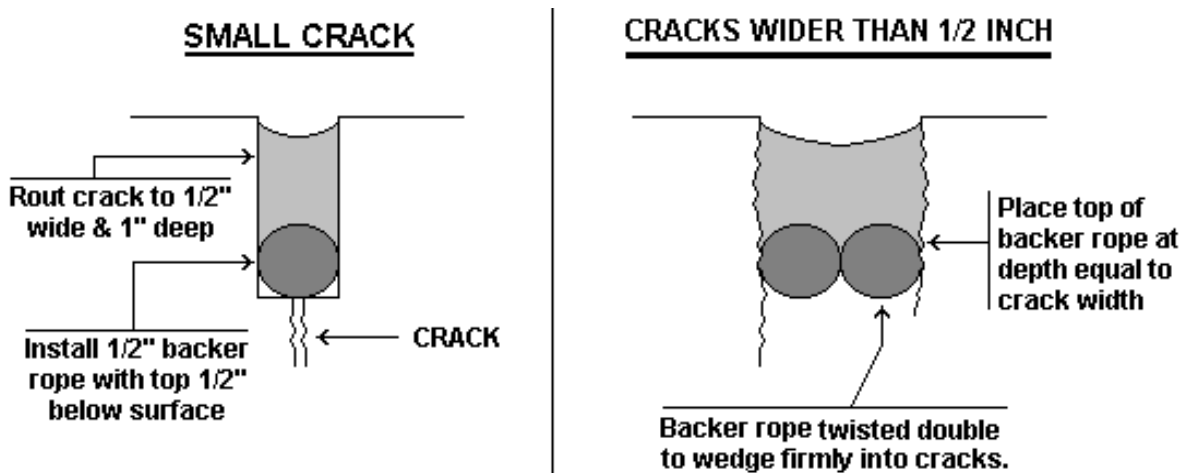


Figure 2. Crack sealing.

Note:

This crack sealing technique is meticulous in its design and procedure. It has a proven record of performance. Using backer rope forces the sealant into a predictable shape—narrow in the center and wide on the sides. This sealant profile allows the sealant to firmly bond with the vertical edges, yet stretch easily with pavement movement. In an effort to minimize labor requirements and reduce crack-sealing costs, an alternative procedure, the overband technique, is presented on the following page. This procedure can produce good results for up to 5 years.

Always remember that, within reasonable limits, thinner sealant material will stretch more easily with the pavement movement, and stay bonded longer.

Overband Technique

A latex modified, fiber reinforced, asphalt cement sealant using the techniques outlined below.

Material

- Blend grade 20 or equivalent asphalt cement with latex rubber at 5 percent by weight of asphalt.
- Again, at 5 percent by weight of asphalt, add polyester fibers into agitator tank.
- Maintain blended asphalt temperature at least 20 degrees below flash point.
- Continuously recycle hot blended asphalt through pumps and hoses when heating kettle is in standby mode.

Application

- Sealant should be applied to dry pavement, with ambient temperatures above 40 degrees.
- Cracks should be sand cleaned and blown free of debris immediately before sealing.
- Application of sealant immediately follows cleaning of the crack.
- Sealant should be pressure applied from a wand-type applicator with a special "overband" nozzle.
- Seat the sealant with a steel-wheeled roller immediately after placement.
- In wider cracks, a backer rope is recommended to limit material quantities required.

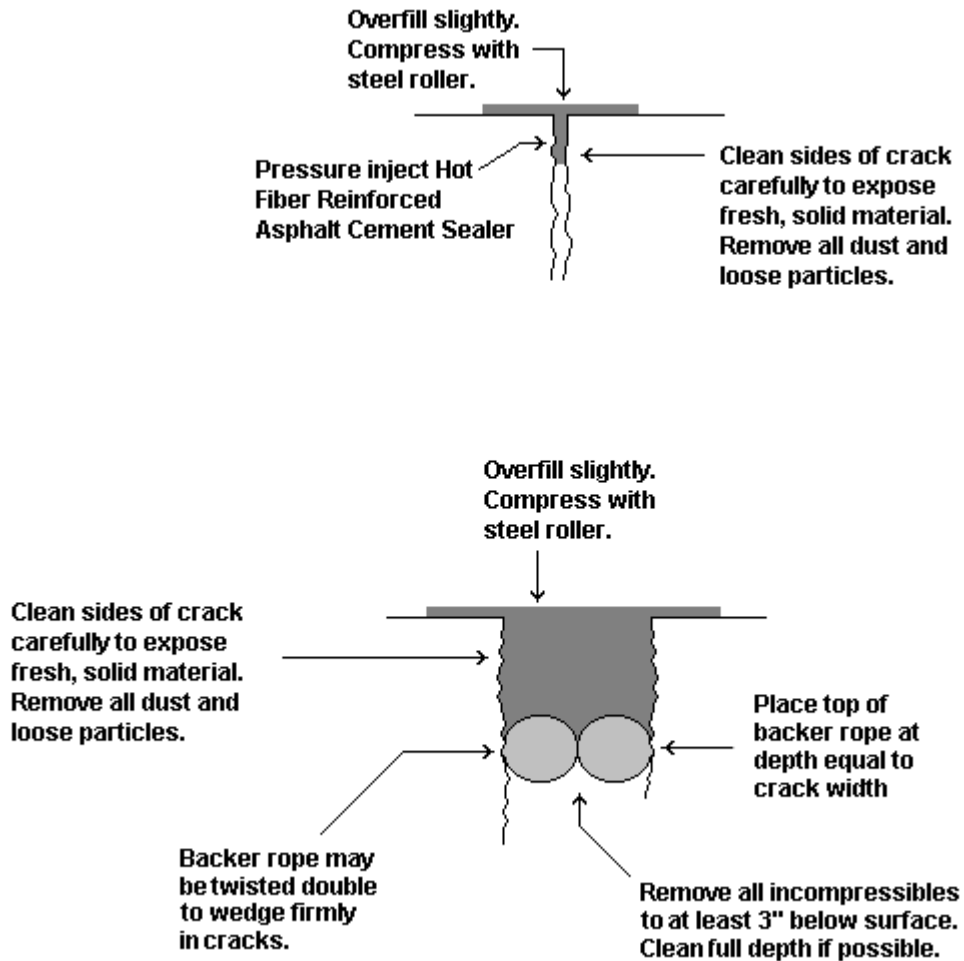


Figure 3. Overband sealing.

Patching (Asphalt Pavement)

Cracks wider than 3 inches should be patched. Cracks with secondary cracking and vertical movement should also be patched. Failed existing patches should be replaced. Patching can also repair small areas of alligator cracking and rutting. A patch differs from sealant in that it restores load-bearing capacity. Therefore, it must be constructed carefully to distribute stresses evenly and perform as an integral piece of the surrounding pavement. The patch must be wide enough to ensure that it bonds to fresh, vital pavement on all sides, and deep enough to reach fresh underlying layers, but never less than 3 inches.

- Examine the distressed area and mark the patch outline. This examination may require a pick or chisel to test the pavement integrity in and around the distressed area.
- The patch area should be cut out with a vertical saw cut not less than 3 inches deep.
- The enclosed pavement should then be removed, leaving the vertical sawed edges undamaged and providing a relatively even, flat floor at the appropriate depth.
- The sides and bottom should be sand cleaned and blown out with compressed air

- The sides and bottom should then be painted with a rapid curing asphalt tack coat. The tack coat may be sprayed on or applied with a brush or rag. Care should be taken to achieve complete coverage without allowing excess material to “pool” on the bottom.
- Allow tack coat to cure (about 2 to 4 hours) until it reaches a gummy consistency, which readily retains the impression of a fingerprint.
- Place hot mixed asphalt concrete evenly and mound slightly above surrounding pavement. Allow approximately ¼ inch of compaction for each inch of patch depth.
- Compact in place with vibratory roller or plate compactor. Asphalt concrete should not be compacted in layers greater than 6 inches. If patch depth is greater than 6 inches, asphalt concrete should be placed and compacted in successive layers.
- In deep, narrow patches such as at joint reflective cracks, a sand asphalt mix may be required in lower layers to allow movement and prevent bridging the adjacent slabs.
- Considerable judgment is required in placing the asphalt concrete to achieve a fully compacted patch without creating a bump or depression. The ¼ inch per inch factor is a rule of thumb. Actual compression will vary with the mix. Experimentation and experience are required to achieve optimum results.

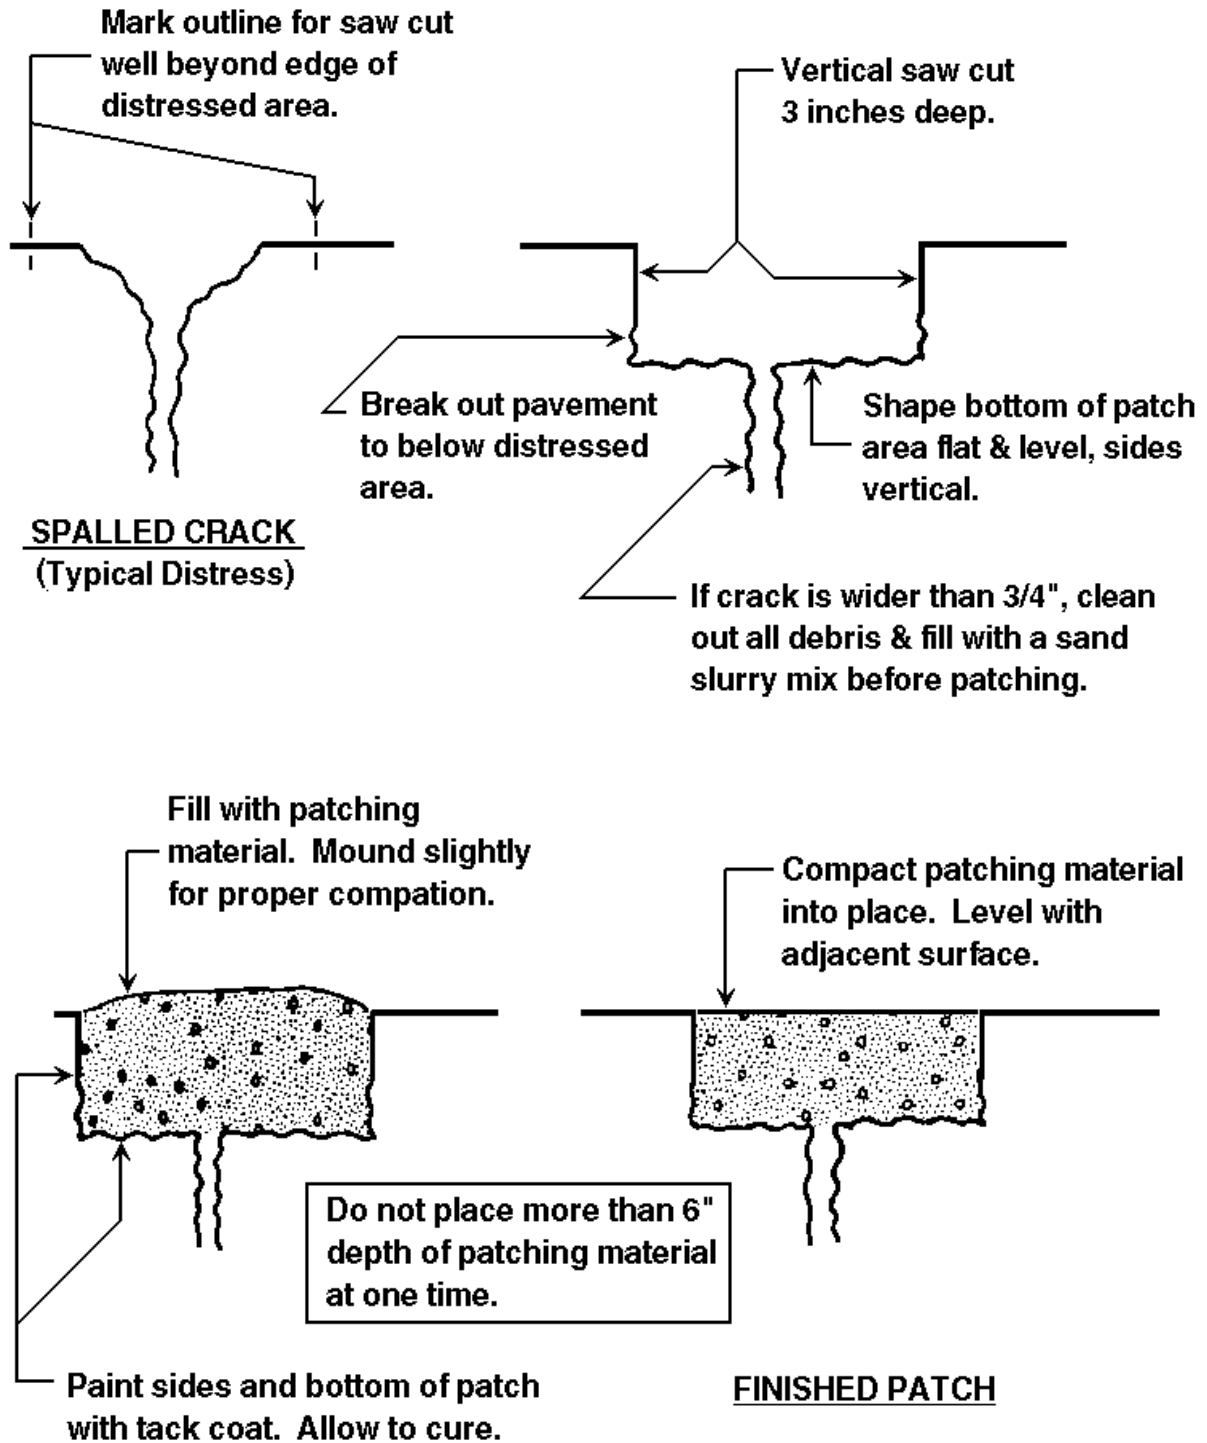


Figure 4. AC patch.

Patching (PCC)

The technique outlined here simulates a thin bonded PCC overlay. This procedure has been proven in service throughout the country.

- Examine the distressed area and mark the patch outline. This examination may require a pick or chisel to test pavement integrity in and around the distressed area.
- Saw cut the area to a depth of 2 inches. The enclosed area is then chipped or jack hammered to solid pavement, but not less than a 2-inch nominal depth.
- The sides and bottom are sand cleaned and air-blasted to expose vital, clean concrete.
- A 25 percent solution of muriatic acid is applied to all exposed surfaces within the patch.
- The muriatic acid solution is thoroughly flushed from the patch area with water.
- Compressed air is used to remove excess water from the area, but exposed concrete must be maintained in a moist condition.
- The sides and bottom of the area are then coated with approximately a 1/16-inch layer of cement grout applied at the consistency of paste. The grout acts as an adhesive to bond the fresh concrete to existing concrete.
- If the patch is adjacent to joints, the continuity of the joint must be maintained by placing inserts approximately the shape of the desired joint against the wall of the patch.
- Before concrete grout begins to dry, concrete is placed in the patch area and is compacted into position with hand tampers or a vibrating plate tamper.
- When the patch has been struck to the proper slope and elevation, a surface texture is applied to approximate the texture of adjacent pavement.
- Joint edges may be edged slightly to remove sharp edges. The patch should be covered with polyethylene or sprayed with a curing compound.
- Clean the surrounding pavement before concrete spillover has a chance to set up.
- The patch may be open to traffic in 72 hours.


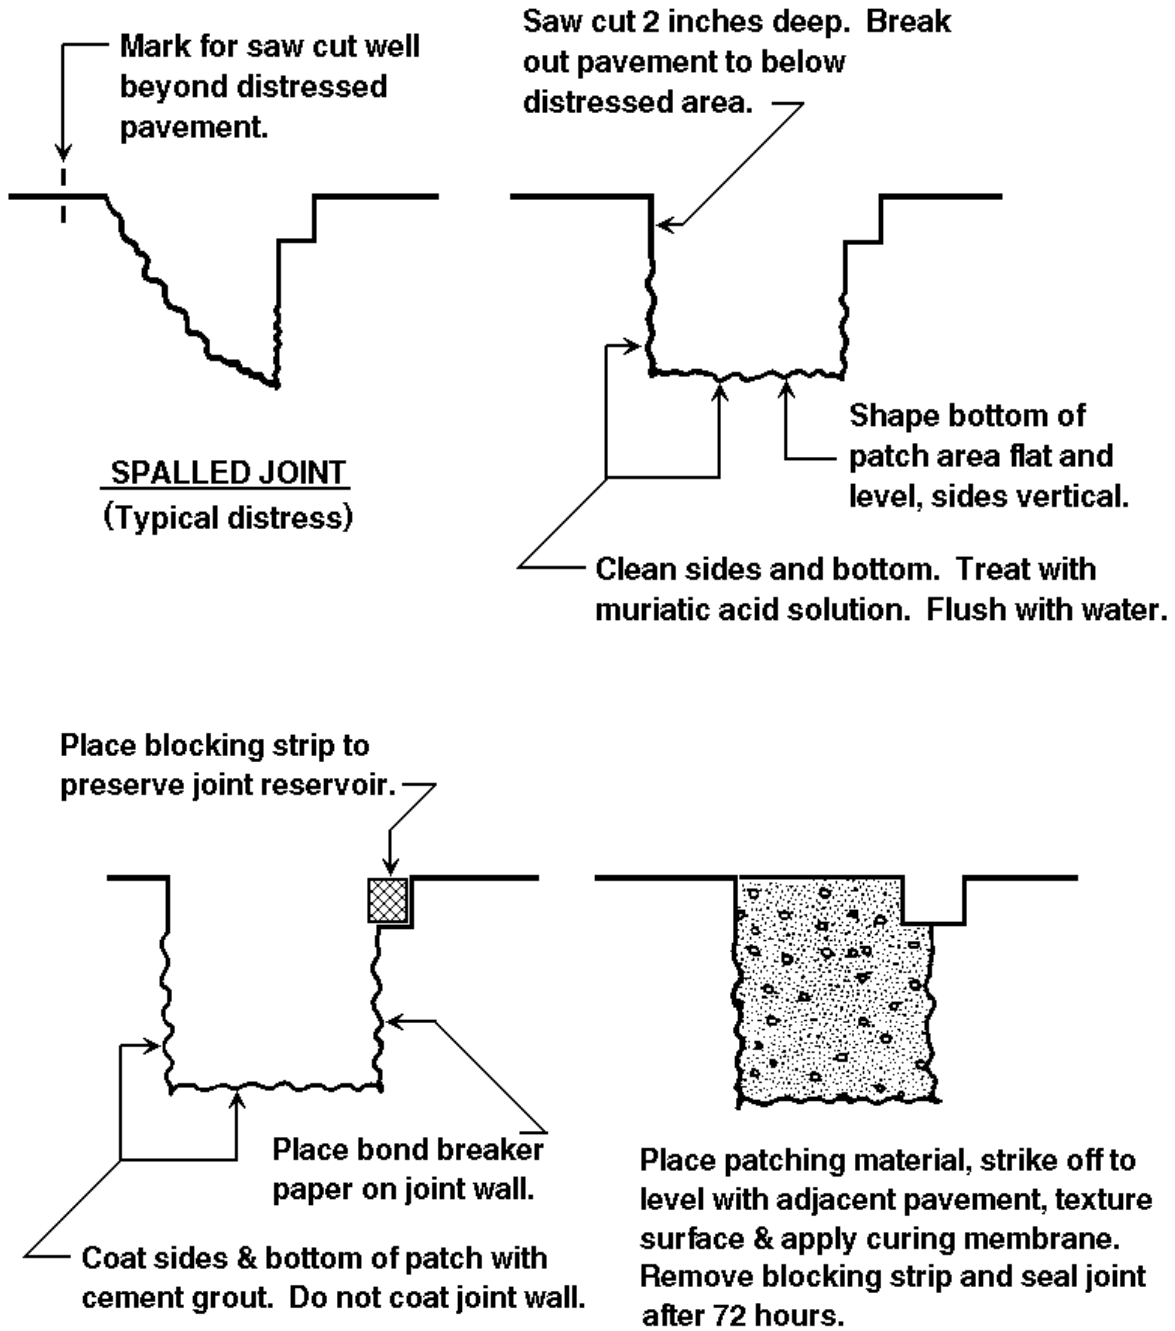


Figure 5. PCC patch.


Joint Repair (PCC)

Seal joints in PCC pavement when existing sealant has deteriorated to a degree that allows water and incompressibles to enter the joint. Hairline cracks are not yet candidates for sealing.

- Rout a reservoir for the sealant. Sealant reservoir should be $\frac{1}{2}$ inch wide and 1 inch deep.
- For cracks wider than $\frac{1}{2}$ inch, the reservoir should be $\frac{1}{4}$ inch wider than the crack. Depth should be such that sealant above the backer rope is at most equal to reservoir width, or as recommended by manufacturer.
- Routed cracks should be sand cleaned, using fine sand at reduced pressure. Proper cleaning will expose fresh, vital pavement on the vertical crack edge.
- Immediately prior to sealing, cracks should be cleaned with compressed air. Ensure that all sand, debris, and incompressibles are removed from the crack. A small hand-held hook or plowing tool may be needed to dislodge some particles. Water cleaning is not recommended, simply because the drying time delays the sealing operation.
- After cleaning with compressed air, a backing material should be placed into the crack. The backer rope may be any compressible substance compatible with bituminous sealant material that will wedge into cracks at a designated depth and support the sealant. Several sizes should be immediately available in the field to accommodate various crack sizes.
- Sealant should be pressure applied with a wand type applicator to within $\frac{1}{4}$ inch of the pavement surface. Follow the equipment manufacturer's instructions.
- The final activity is to clean the surrounding pavement area. A vacuum sweeper works well. Brooms should not be used until the sealant has taken an initial set.

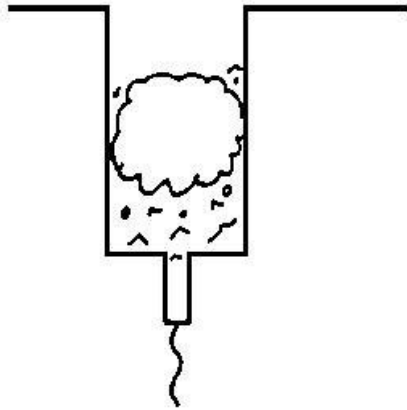

Typical joint with deficient sealant and a collection of debris & incompressibles.

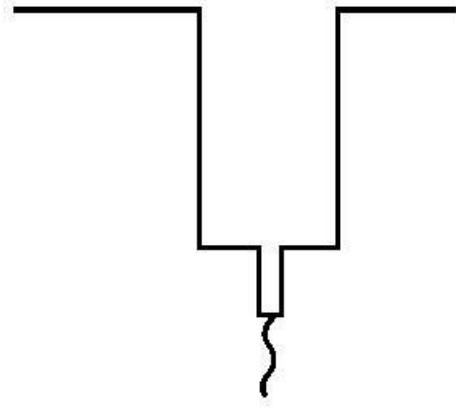

Rout out old sealant, debris and incompressibles. Clean joint sides to expose fresh, clean concrete and stone. Retain existing reservoir shape.

Fill to 1/8" below surface.
Do not overfill.

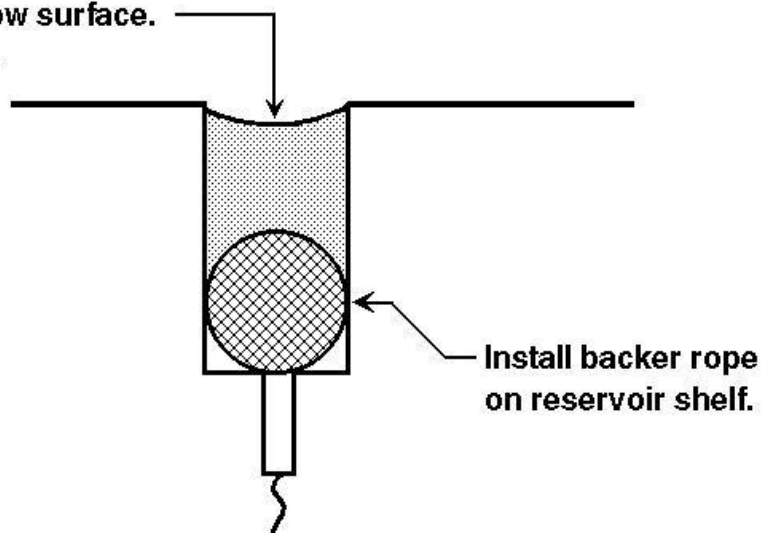


Figure 6. PCC joint/crack repair.

Table 1. Maintenance and “drive by” inspection log.

Inspection Date	Inspector	Pavement location (branch/section)	Change in condition (new distress type, increased quantity or severity)	Maintenance performed since last inspection